


SEE CONTROL PANEL WIRING DIAGRAM FOR WIRING CONNECTIONS TO KILN ZONE RECEPTACLES

1 Phase Electrical Specs			
Voltage	208 / 1 / 50-60		
Watts	8,320		
Full Load Amps	L1	L2	
	40.0	40.0	
Power Supply	Fuse	Wire	
	50A	8AWG	

1 Phase Electrical Specs			
Voltage	220 / 1 / 50-60		
Watts	8,360		
Full Load Amps	L1	L2	
	38.0	38.0	
Power Supply	Fuse	Wire	
	50A	8AWG	

1 Phase Electrical Specs			
Voltage	240 / 1 / 50-60		
Watts	9,120		
Full Load Amps	L1	L2	
	38.0	38.0	
Power Supply	Fuse	Wire	
	50A	8AWG	

3 Phase Electrical Specs			
Voltage	208 / 3 / 50-60		
Watts	8,320		
Full Load Amps	L1	L2	L3
	34.6	34.6	34.6
Power Supply	Fuse	Wire	
	50A	8AWG	



3 Phase Electrical Specs			
Voltage	240 / 3 / 50-60		
Watts	9,120		
Full Load Amps	L1	L2	L3
	32.9	32.9	32.9
Power Supply	Fuse	Wire	
	50A	8AWG	

3 Phase Wye Electrical Specs			
Voltage	380 / 3-Y / 50-60		
Watts	8,360		
Full Load Amps	L1	L2	L3
	19.0	19.0	19.0
Power Supply	Fuse	Wire	
	25A	12AWG	

3 Phase Wye Electrical Specs			
Voltage	400 / 3-Y / 50-60		
Watts	8,360		
Full Load Amps	L1	L2	L3
	18.2	18.2	18.2
Power Supply	Fuse	Wire	
	25A	12AWG	

3 Phase Wye Electrical Specs			
Voltage	415 / 3-Y / 50-60		
Watts	9,120		
Full Load Amps	L1	L2	L3
	19.0	19.0	19.0
Power Supply	Fuse	Wire	
	25A	12AWG	


Associated Control Panels

Model	JD2918	JD2918-3P	JD2918-3PY			
Type						
Diagram						

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.


This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

THERMOCOUPLE LOCATIONS

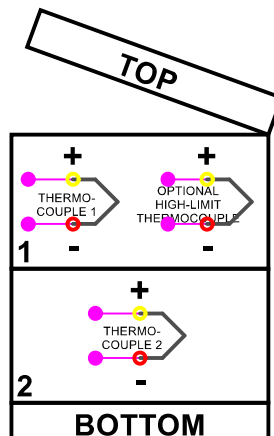


ELEMENT CONNECTIONS

LEGACY DESIGN

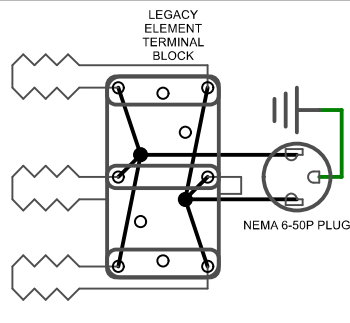


KILN SECTIONS

QUAD

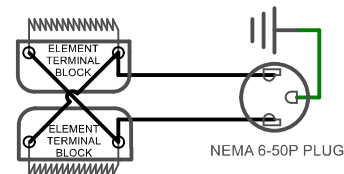

KILN SECTIONS

CURRENT DESIGN

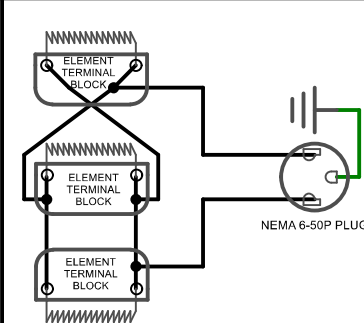

KILN SECTIONS



**CAUTION: DO NOT PLUG
KILN SECTIONS DIRECTLY
TO LINE VOLTAGE**

JD2918 Kiln Diagram



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

K0007