


STEP 1

USE A PALLET JACK
OR FORKLIFT TO
ELEVATE THE KILN ~1"


LIFTING POINT

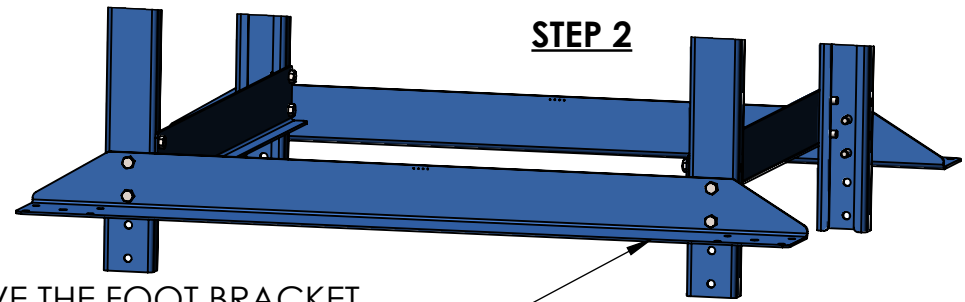

STEP 2

REMOVE THE FOOT BRACKET,
THEN REATTACH IT USING THE
TOP SET OF HOLES

STEP 3 (REPEAT FOR EACH LEG)

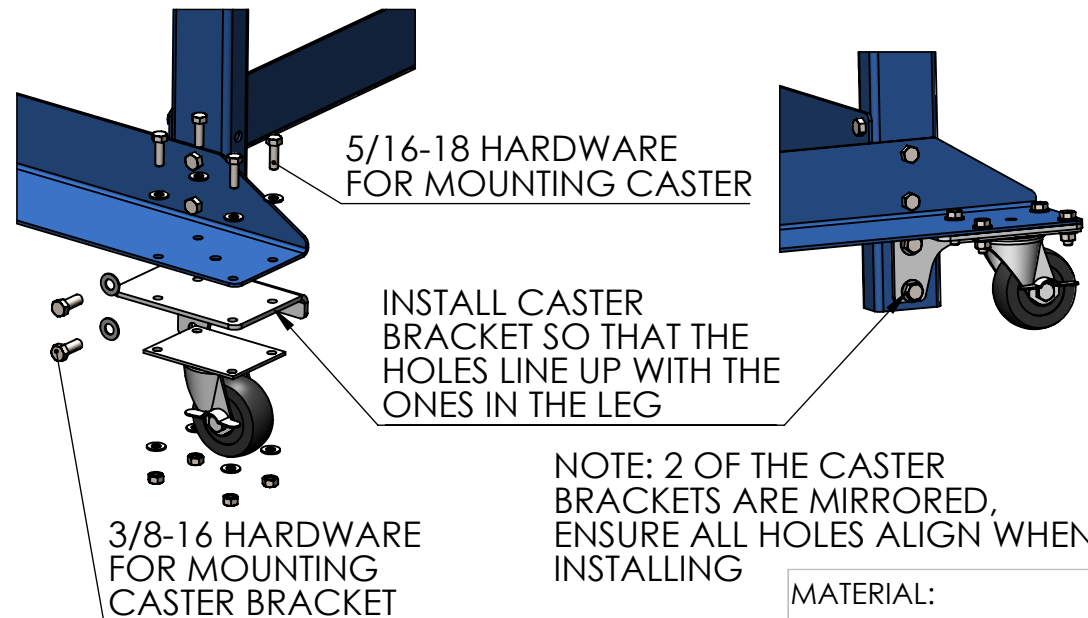

5/16-18 HARDWARE
FOR MOUNTING CASTER

INSTALL CASTER
BRACKET SO THAT THE
HOLES LINE UP WITH THE
ONES IN THE LEG

3/8-16 HARDWARE
FOR MOUNTING
CASTER BRACKET

NOTE: 2 OF THE CASTER
BRACKETS ARE MIRRORED,
ENSURE ALL HOLES ALIGN WHEN
INSTALLING

ITEM	QUANTITY PER LEG	TOTAL QUANTITY
5/16-18 BOLT	4	16
5/16-18 NUT	4	16
5/16 WASHER	8	32
3/8-16 BOLT	2	8
3/8-16 NUT	2	8
3/8 WASHER	4	16
CASTER BRACKET	1	4
CASTER WHEEL	1	4

THE INFORMATION CONTAINED IN THIS DRAWING IS THE
SOLE PROPERTY OF L&L KILN MFG INC. ANY
REPRODUCTION IN PART OR AS A WHOLE WITHOUT THE
WRITTEN PERMISSION OF L&L KILN MFG INC. IS PROHIBITED.

DRAWN BY
DSL

DATE
6/11/25

SCALE
1:20

TITLE
eFL CASTER ASSEMBLY



505 SHARPTOWN RD
SWEDESBORO NJ 08085
PH: (856) 294-0077
FAX: (856) 294-0070

MATERIAL:
FINISH:

REV
0.1

SHEET OF
1/1

DRAWING NO.