


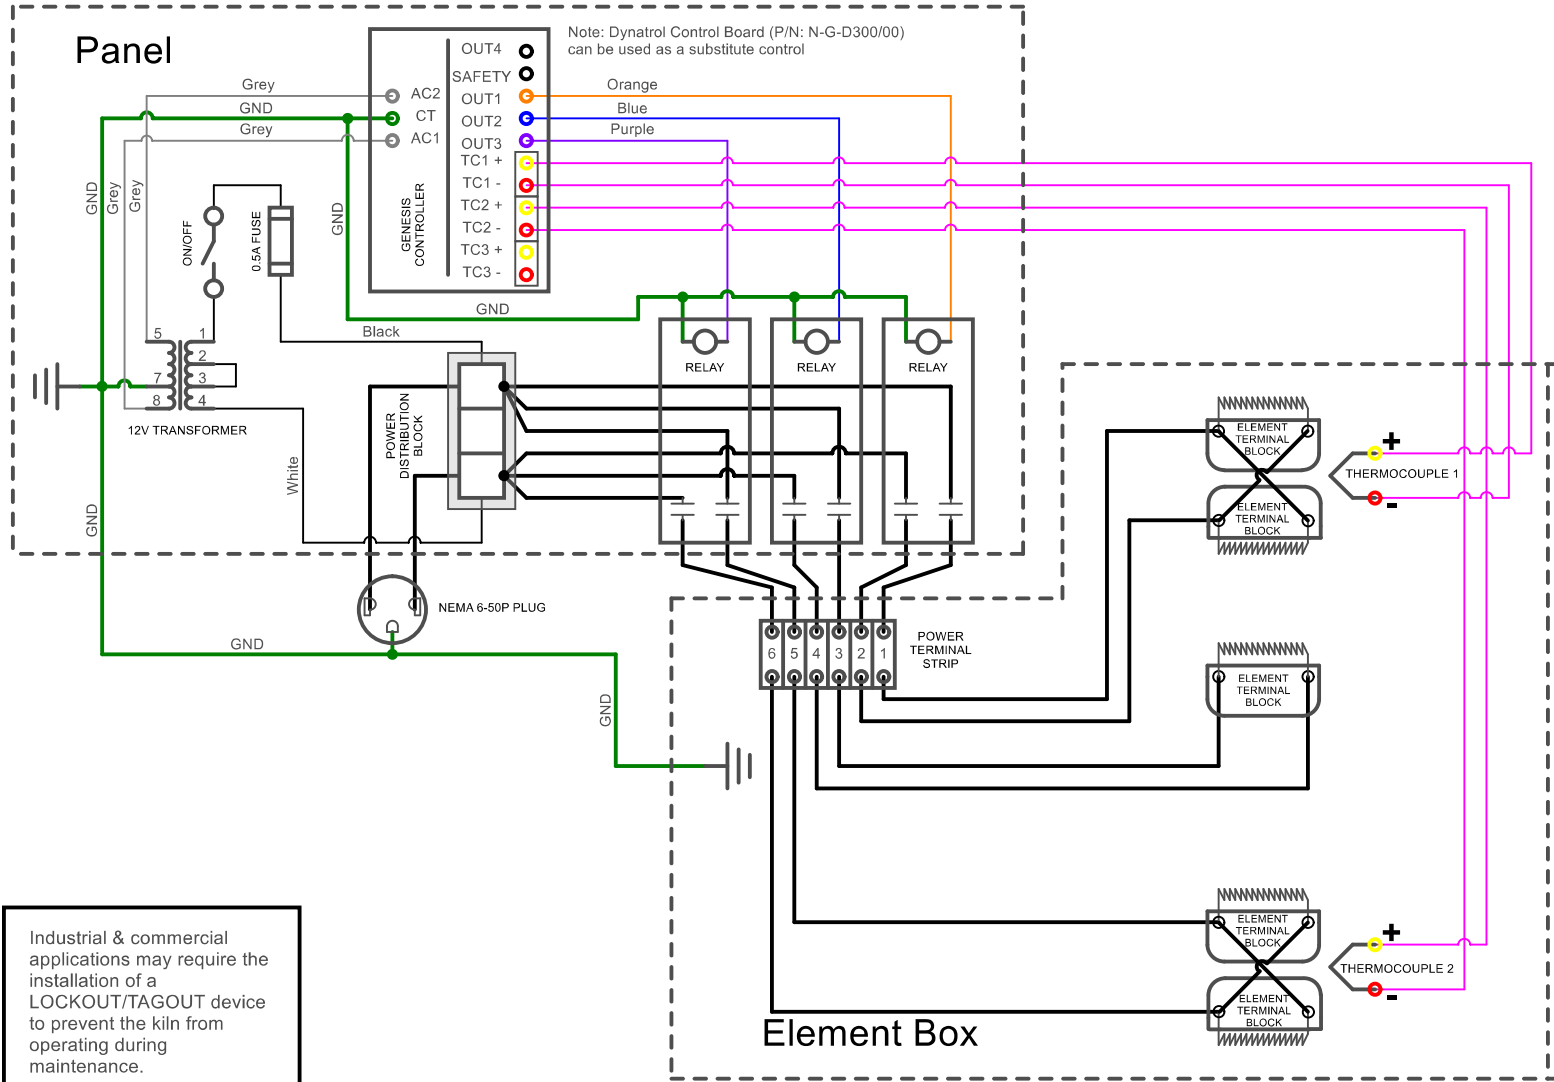

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: e18M-208			
Voltage	208 / 1 / 50-60		
Watts	8,000		
Full Load Amps	L1	L2	L3
	38.5	38.5	
Power Supply	Fuse	Wire	
	50A	8AWG	
Elements	QTY	OHMS	
E-E-18ML/21	5	26.03	

Model: e18M-240			
Voltage	240 / 1 / 50-60		
Watts	8,000		
Full Load Amps	L1	L2	L3
	33.3	33.3	
Power Supply	Fuse	Wire	
	50A	8AWG	
Elements	QTY	OHMS	
E-E-18ML/31	5	34.65	

E18M Easy-Fire 1 Phase 208V, 240V			 505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com (856)-294-0077 Drawn by: JS
Rev.	Date	Description	
			C0004