


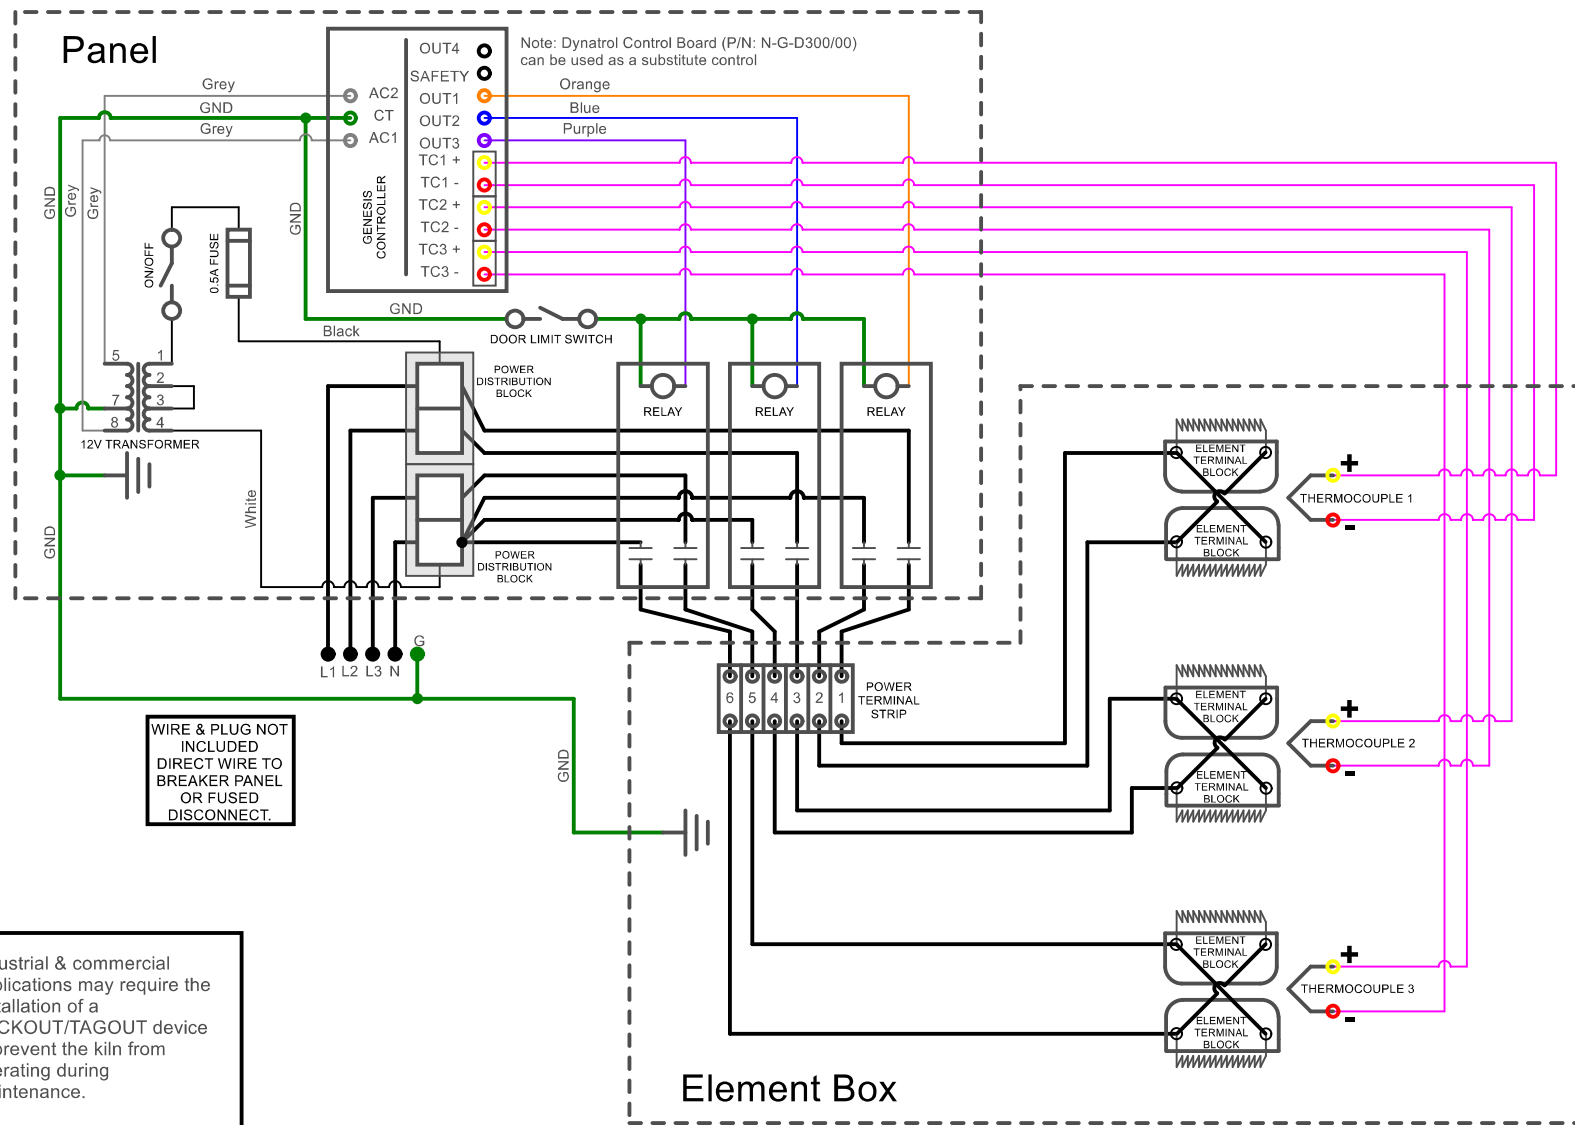

WIRE & PLUG NOT INCLUDED
DIRECT WIRE TO
BREAKER PANEL
OR FUSED
DISCONNECT.

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: eFL1626-380-3PY			
Voltage	380 / 3-Y / 50-60		
Watts	12,500		
Full Load Amps	L1	L2	L3
	18.9	18.9	18.9
Power Supply	Fuse	Wire	
	25A	12AWG	
Elements	QTY	OHMS	
	6	22.4	

Model: eFL1626-400-3PY			
Voltage	400 / 3-Y / 50-60		
Watts	12,500		
Full Load Amps	L1	L2	L3
	18.1	18.1	18.1
Power Supply	Fuse	Wire	
	25A	12AWG	
Elements	QTY	OHMS	
	6	22.4	

Model: eFL1626-415-3PY			
Voltage	415 / 3-Y / 50-60		
Watts	12,500		
Full Load Amps	L1	L2	L3
	17.4	17.4	17.4
Power Supply	Fuse	Wire	
	25A	12AWG	
Elements	QTY	OHMS	
	6	26.6	

eFL1626 3 Phase Wye 380V, 400V, 415V			
			505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com (856)-294-0077 Drawn by: JS
Rev.	Date	Description	