


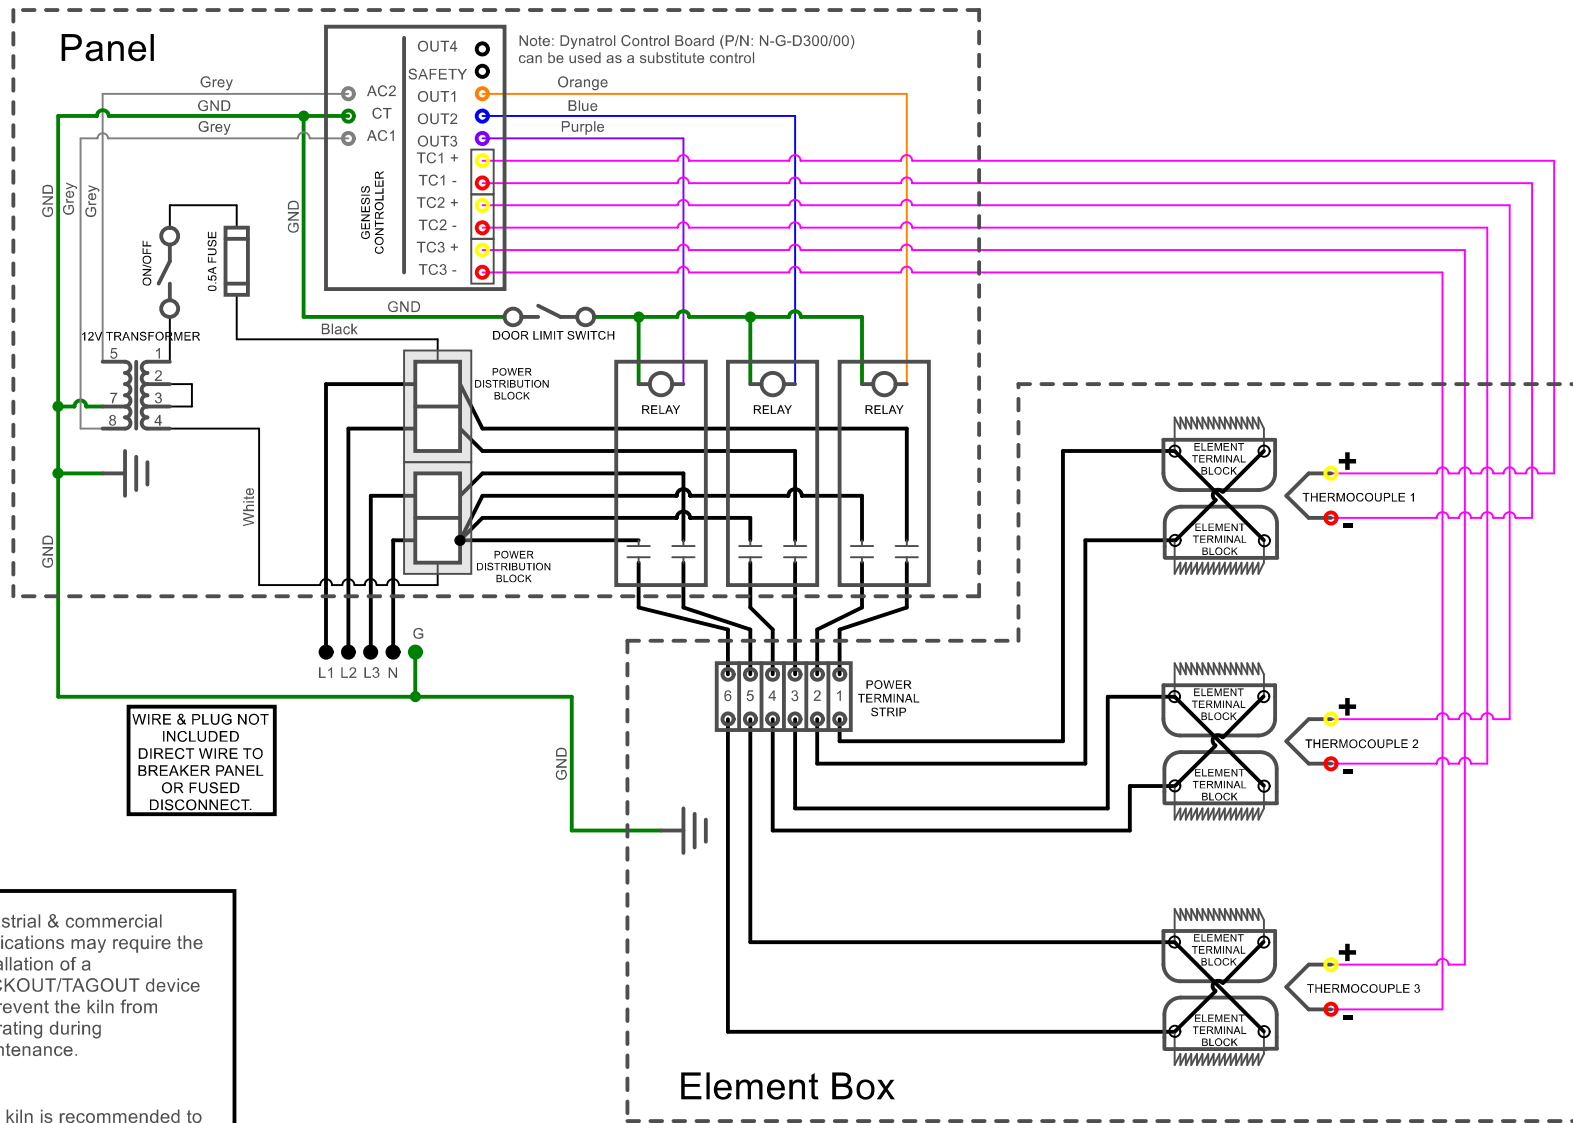

WIRE & PLUG NOT INCLUDED
DIRECT WIRE TO
BREAKER PANEL
OR FUSED
DISCONNECT.

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: eFL2626-380-3PY			
Voltage	380 / 3-Y / 50-60		
Watts	15,360		
Full Load Amps	L1 L2 L3		
	23.3 23.3 23.3		
Power Supply	Fuse Wire		
	30A 10AWG		
Elements	QTY OHMS		
E-H-2626/41	6 18.2		

Model: eFL2626-400-3PY			
Voltage	400 / 3-Y / 50-60		
Watts	15,360		
Full Load Amps	L1 L2 L3		
	22.3 22.3 22.3		
Power Supply	Fuse Wire		
	30A 10AWG		
Elements	QTY OHMS		
E-H-2626/41	6 18.2		

Model: eFL2626-415-3PY			
Voltage	415 / 3-Y / 50-60		
Watts	15,360		
Full Load Amps	L1 L2 L3		
	21.3 21.3 21.3		
Power Supply	Fuse Wire		
	30A 10AWG		
Elements	QTY OHMS		
E-H-2626/31	6 21.7		

eFL2626 3 Phase Wye 380V, 400V, 415V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

Rev. Date Description C0080