


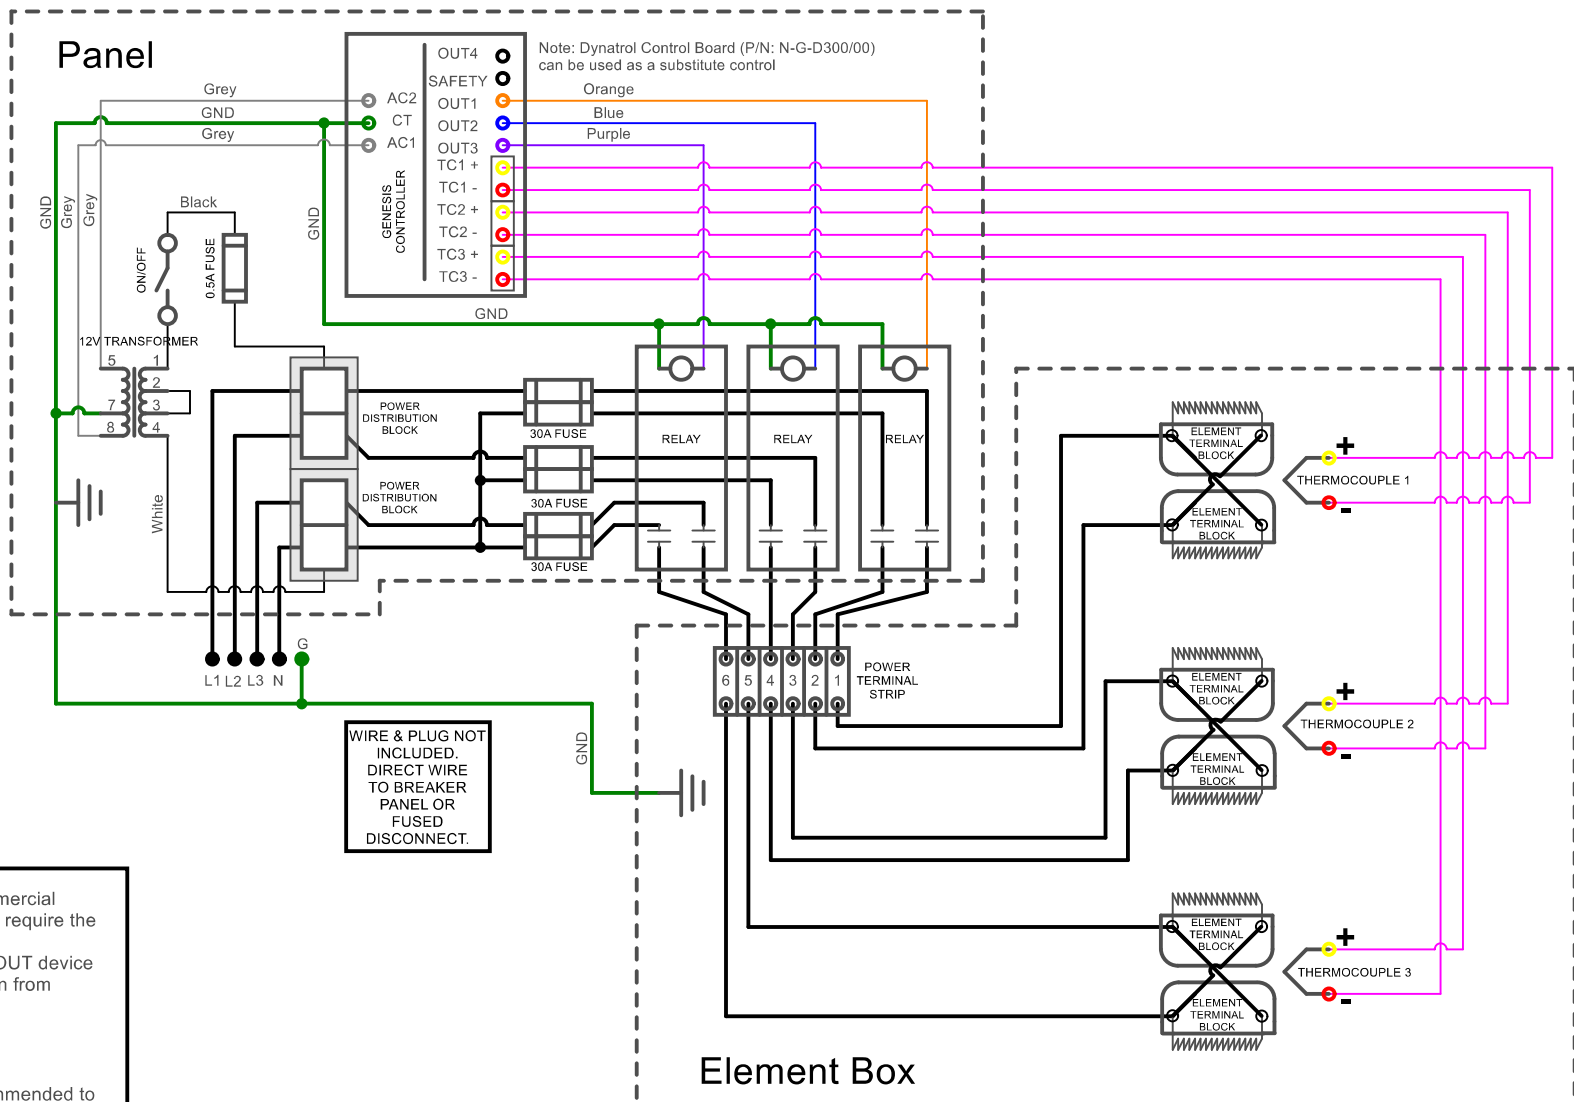

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: eQ2327-380-3PY	
Voltage	380 / 3-Y / 50-60
Watts	12,321
Full Load Amps	L1 L2 L3
	18.7 18.7 18.7
Power Supply	Fuse Wire
	25A 12AWG
Elements	QTY OHMS
E-Q-2327/40	6 22.7

Model: eQ2327-400-3PY	
Voltage	400 / 3-Y / 50-60
Watts	13,992
Full Load Amps	L1 L2 L3
	20.3 20.3 20.3
Power Supply	Fuse Wire
	30A 10AWG
Elements	QTY OHMS
E-Q-2327/40	6 22.7

Model: eQ2327-415-3PY	
Voltage	415 / 3-Y / 50-60
Watts	13,440
Full Load Amps	L1 L2 L3
	18.7 18.7 18.7
Power Supply	Fuse Wire
	25A 10AWG
Elements	QTY OHMS
E-Q-2327/30	6 24.8

eQ2327 eQuad-Pro 3 Phase Wye

380V, 400V, 415V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

C0087

Rev.

Date

Description