


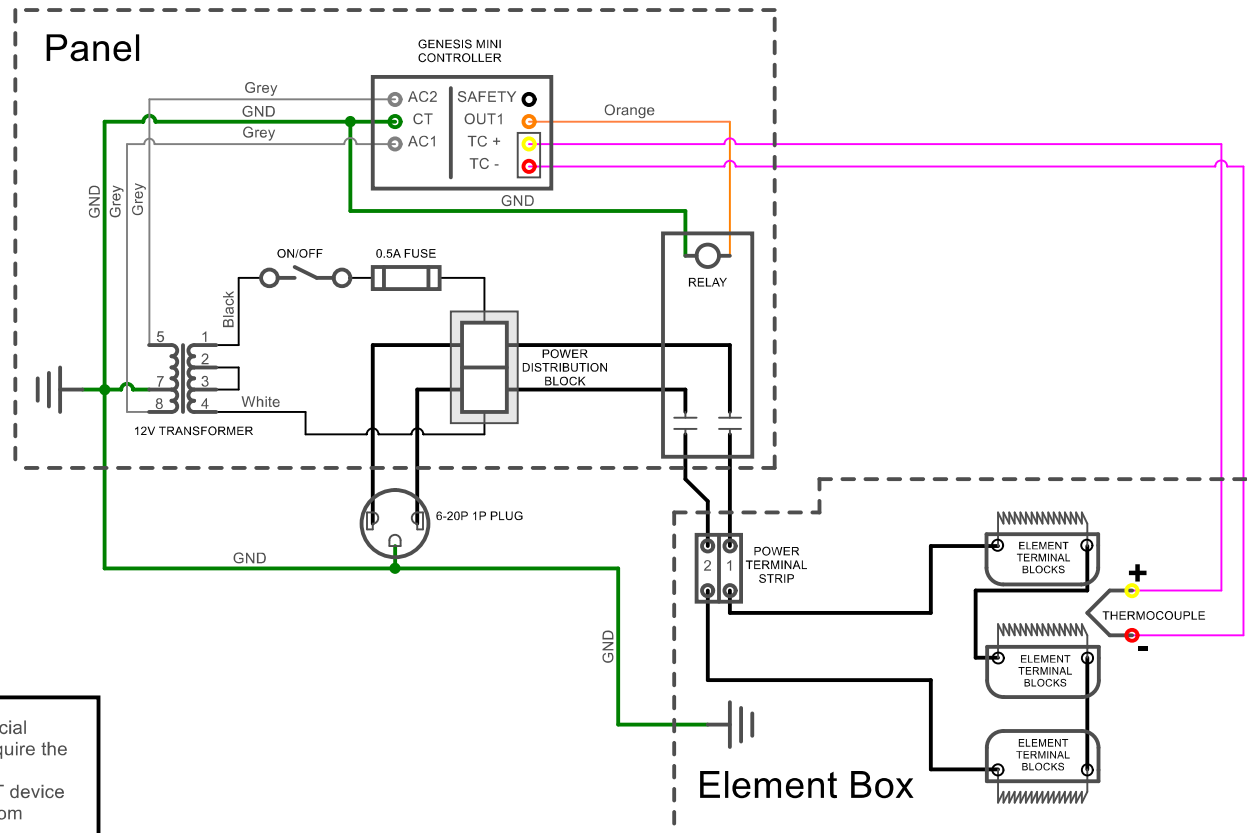

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16-22AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: DLH11-DX-208			
Voltage	208 / 1 / 50-60		
Watts	2,800		
Full Load Amps	L1	L2	L3
	13.5	13.5	
Power Supply	Fuse	Wire	
	20A	14AWG	
Elements	QTY	OHMS	
E-D-DHLL/20	3	5.0	

Model: DLH11-DX-240				
Voltage		240 / 1 / 50-60		
Watts		2,800		
Full Load Amps	L1	L2	L3	
	11.7	11.7		
Power Supply	Fuse		Wire	
	15A		14AWG	
Elements	QTY	OHMS		
E-D-DHLL/30	3	6.6		

DLH11-DX 1 Phase 208V, 240V			 505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com (856)-294-0077 Drawn by: JS
Rev.	Date	Description	
			C0042