


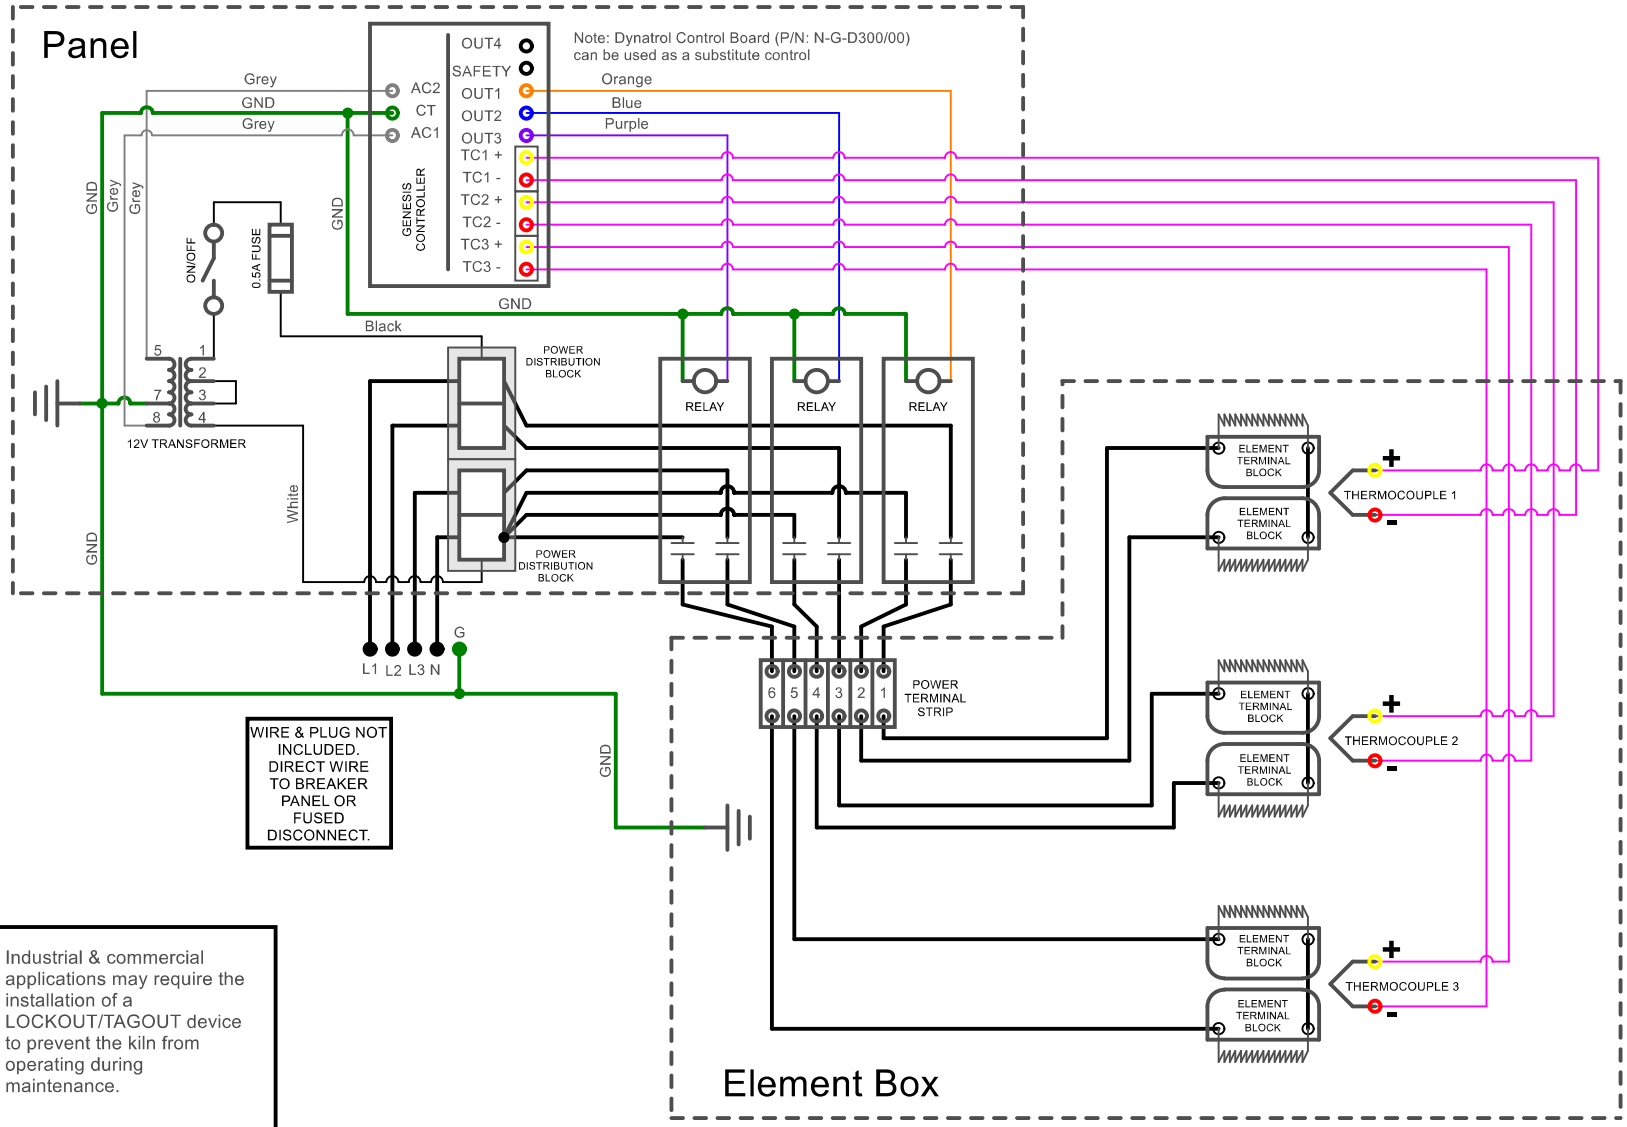

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16-22AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: e18T-380-3PY			
Voltage	380 / 3-Y / 50-60		
Watts	8,400		
Full Load Amps	L1	L2	L3
	12.7	12.7	12.7
Power Supply	Fuse	Wire	
	20A	14AWG	
Elements	QTY	OHMS	
E-E-18TL/41	6	8.32	

E18T Easy-Fire 3 Phase Wye 380V, 400V, 415V			
		505 Sharptown Road Swedesboro NJ 08085	
		service@hotkilns.com	
		(856)-294-0077	
		Drawn by: JS	
Rev.	Date	Description	C0013