


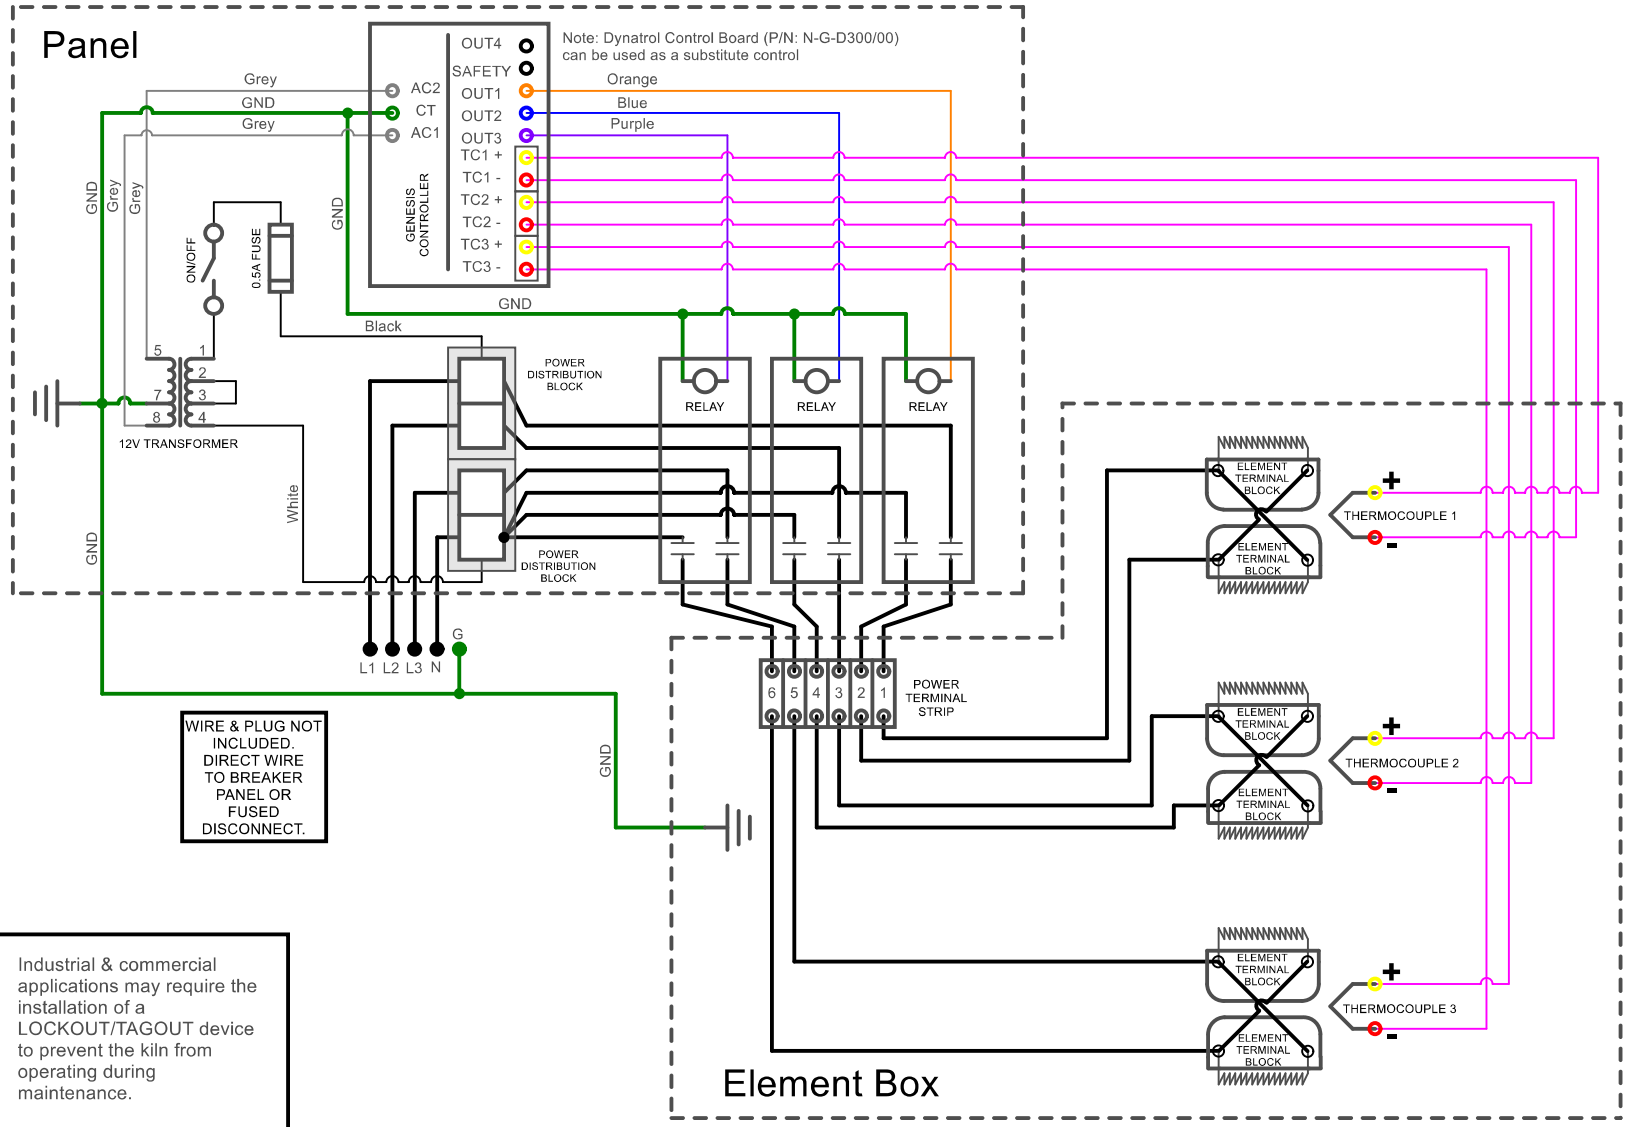

WIRE & PLUG NOT INCLUDED. DIRECT WIRE TO BREAKER PANEL OR FUSED DISCONNECT.

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16-22AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: e28T-380-3PY	
Voltage	380 / 3-Y / 50-60
Watts	15,060
Full Load Amps	L1 22.8 L2 22.8 L3 22.8
Power Supply	Fuse 30A Wire 10AWG
Standard Elements: E-E-28TL/42 Quad Elements: E-E-28TU/42	
Quantity: 6	Ohms: 18.6

Model: e28T-400-3PY	
Voltage	400 / 3-Y / 50-60
Watts	17,102
Full Load Amps	L1 24.8 L2 24.8 L3 24.8
Power Supply	Fuse 40A Wire 10AWG
Standard Elements: E-E-28TL/42 Quad Elements: E-E-28TU/42	
Quantity: 6	Ohms: 18.6

Model: e28T-415-3PY	
Voltage	415 / 3-Y / 50-60
Watts	16,620
Full Load Amps	L1 23.1 L2 23.1 L3 23.1
Power Supply	Fuse 30A Wire 10AWG
Standard Elements: E-E-28TL/32 Quad Elements: E-E-28TU/32	
Quantity: 6	Ohms: 20.0

E28T Easy-Fire 3 Phase Wye 380V, 400V, 415V			 505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com (856)-294-0077 Drawn by: JS
Rev.	Date	Description	
			C0037