


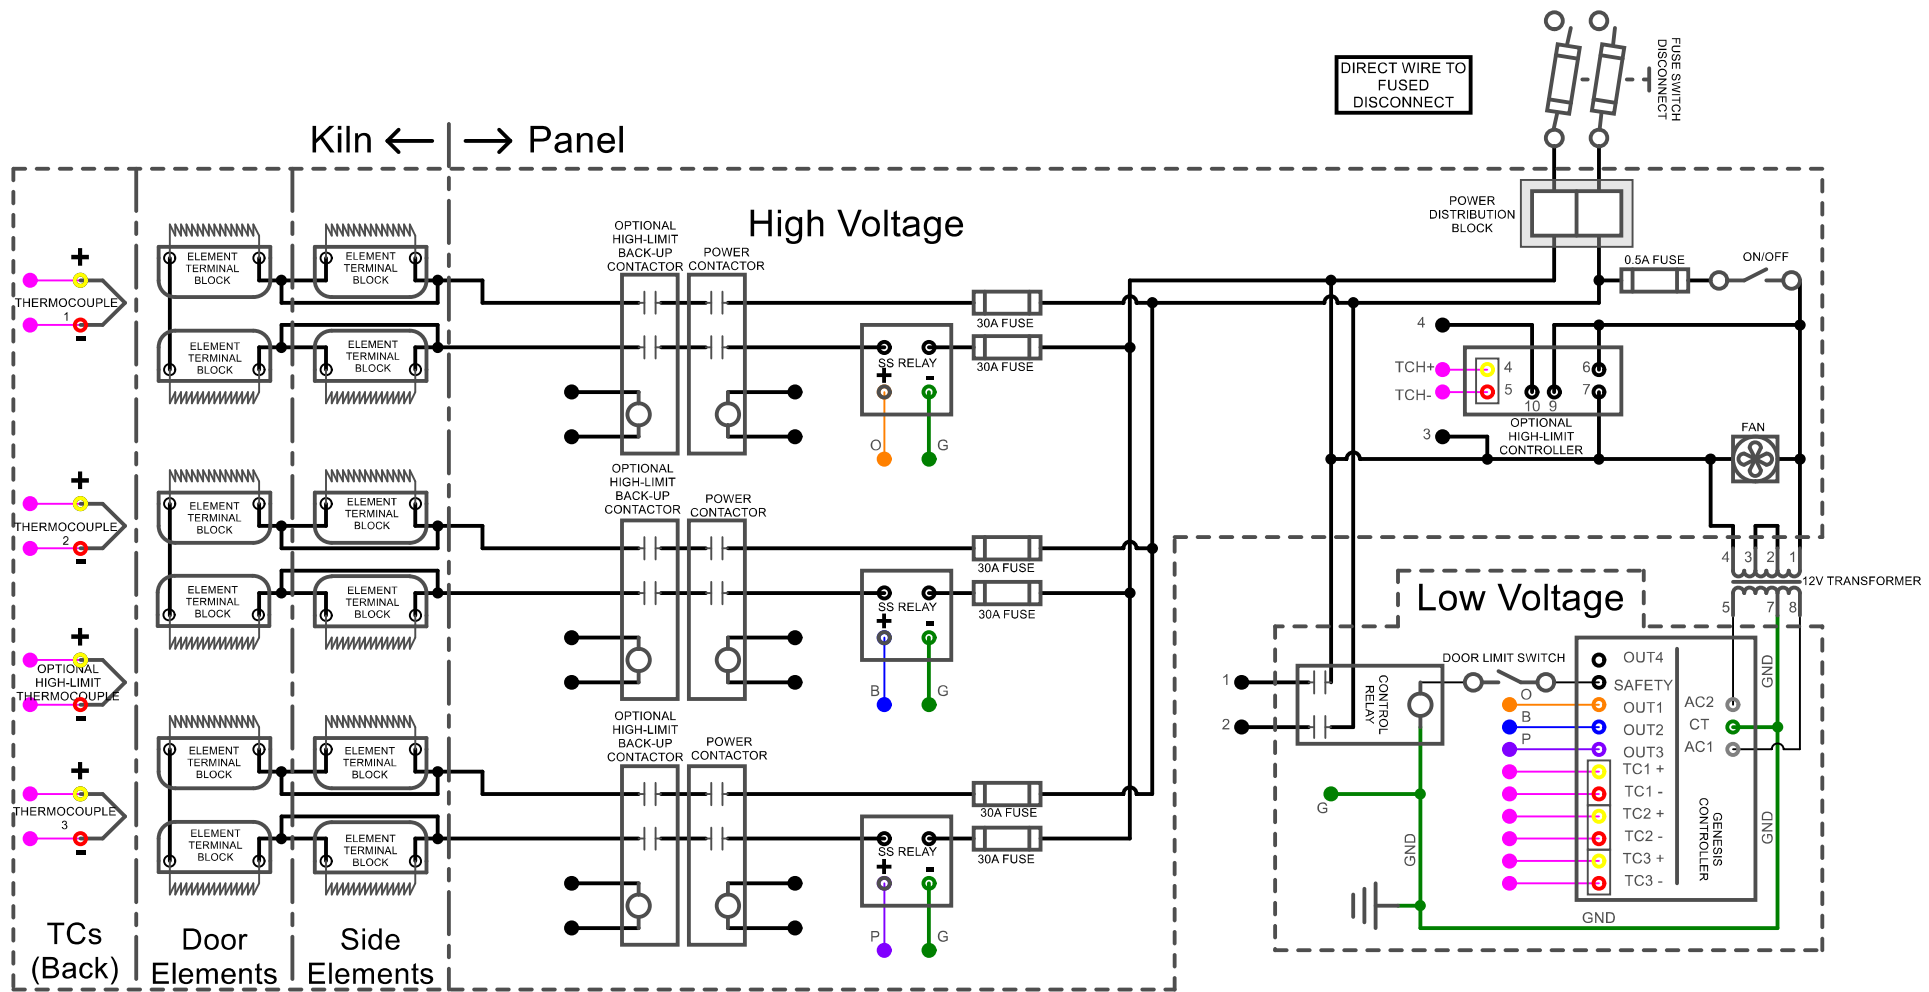

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Model: EL2427-208				
Voltage	208 / 1 / 50-60			
Watts	16,500			
Full Load Amps	L1	L2	L3	
	26.4	26.4		
Power Supply	Fuse		Wire	
	40A		10AWG	
Side Elements: E-Z-2427/2S				
Quantity: 6	Ohms:		11.4	
Door Elements: E-Z-2427/2D				
Quantity: 6	Ohms:		3.8	

Model: EL2427-220				
Voltage	220 / 1 / 50-60			
Watts	16,500			
Full Load Amps	L1	L2	L3	
	75.0	75.0		
Power Supply	Fuse	Wire		
	100A	3AWG		
Side Elements: E-Z-2427/4S				
Quantity: 6	Ohms: 12.7			
Door Elements: E-Z-2427/4D				
Quantity: 6	Ohms: 4.2			

Model: EL2427-240				
Voltage	240 / 1 / 50-60			
Watts	16,500			
Full Load Amps	L1	L2	L3	
	68.8	68.8		
Power Supply	Fuse	Wire		
	90A	3AWG		
Side Elements: E-Z-2427/3S				
Quantity: 6	Ohms: 15.1			
Door Elements: E-Z-2427/3D				
Quantity: 6	Ohms: 5			

EL2427 1 Phase 208V, 220V, 240V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

C0048