


Panel

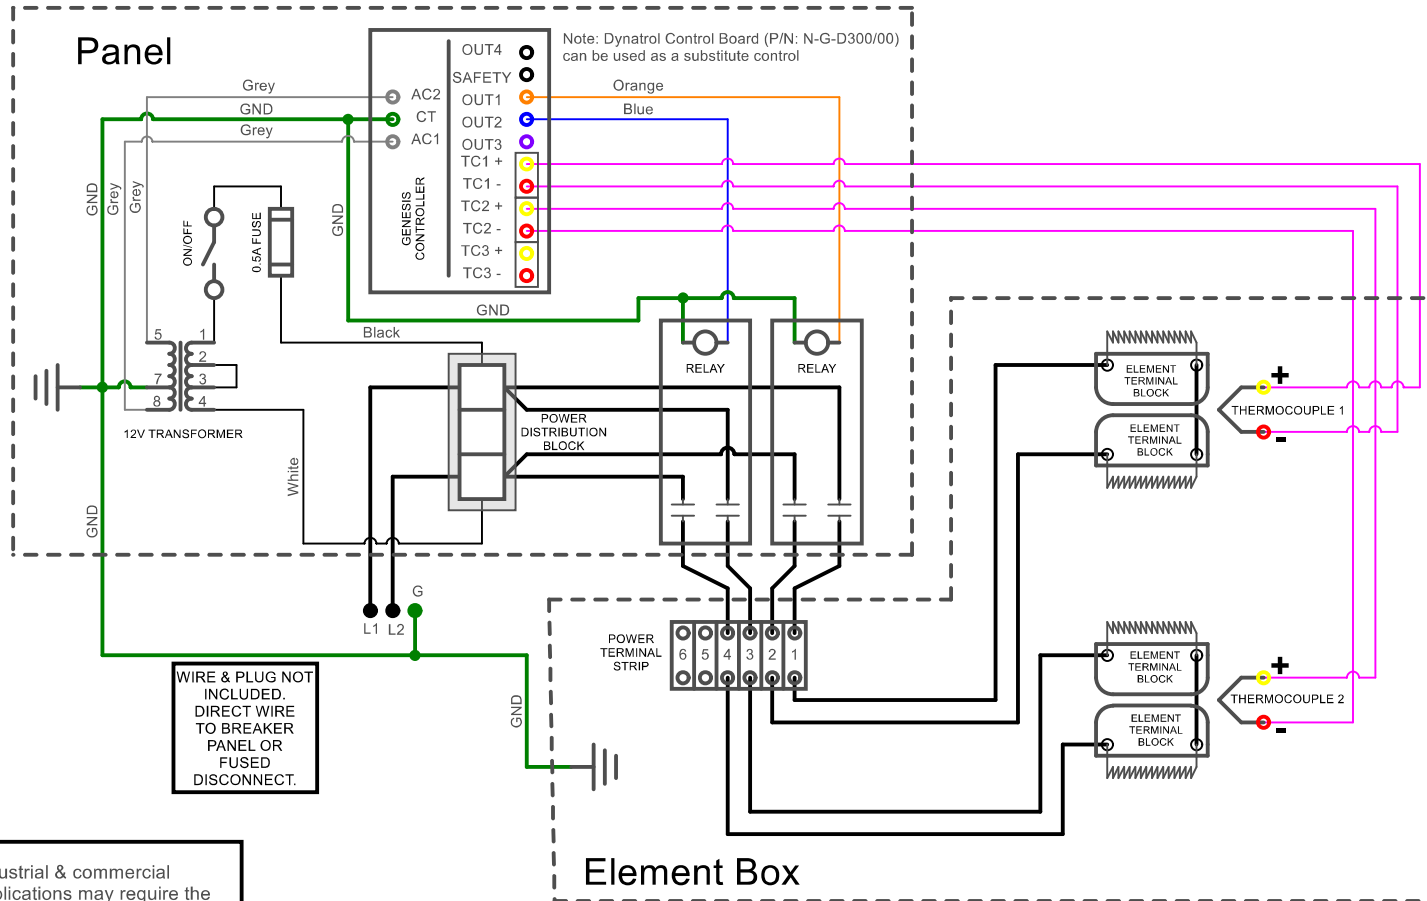

Element Box

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	18AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size	

Model: e18S-220		
Voltage	220 / 1 / 50-60	
Watts	5,268	
Full Load Amps	L1	L2 L3
	23.9	23.9
Power Supply	Fuse	Wire
	30A	10AWG
Elements	QTY	OHMS
	E-E-18SL/41	4 8.84

E18S Easy-Fire 1 Phase 220V 220V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

C0007

Rev. Date Description