


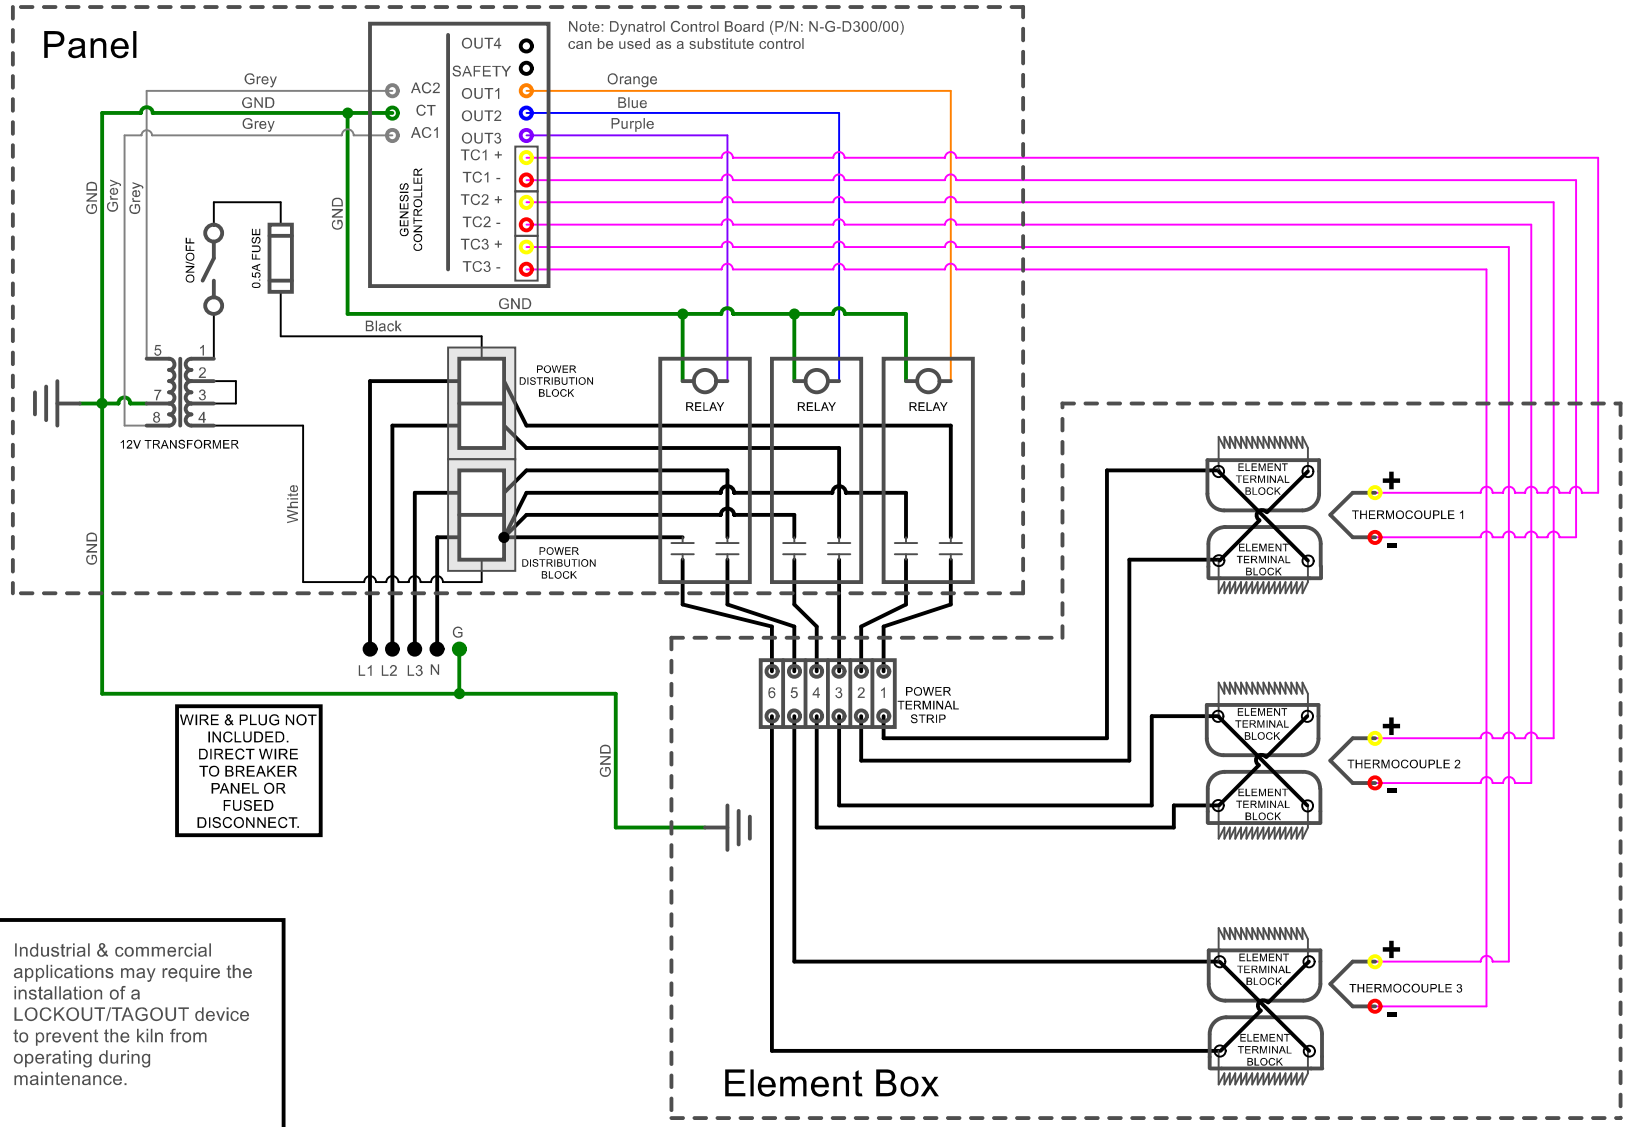

WIRE & PLUG NOT INCLUDED. DIRECT WIRE TO BREAKER PANEL OR FUSED DISCONNECT.

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: e23T-380-3PY		
Voltage	380 / 3-Y / 50-60	
Watts	11,400	
Full Load Amps	L1	L2
	17.3	17.3
Power Supply	Fuse	Wire
	25A	12AWG
Standard Elements: E-E-23TL/42		
Quad Elements: E-E-23TU/42		
Quantity: 6	Ohms: 24.5	

Model: e23T-400-3PY		
Voltage	400 / 3-Y / 50-60	
Watts	12,945	
Full Load Amps	L1	L2
	18.8	18.8
Power Supply	Fuse	Wire
	25A	12AWG
Standard Elements: E-E-23TL/42		
Quad Elements: E-E-23TU/42		
Quantity: 6	Ohms: 24.5	

Model: e23T-415-3PY		
Voltage	415 / 3-Y / 50-60	
Watts	11,520	
Full Load Amps	L1	L2
	16.0	16.0
Power Supply	Fuse	Wire
	20A	14AWG
Standard Elements: E-E-23TL/31		
Quad Elements: E-E-23TU/31		
Quantity: 6	Ohms: 28.9	

E23T Easy-Fire 3 Phase Wye 380V, 400V, 415V			
		505 Sharptown Road Swedesboro NJ 08085	
		service@hotkilns.com	
		(856)-294-0077	
		Drawn by: JS	
Rev.	Date	Description	C0025