


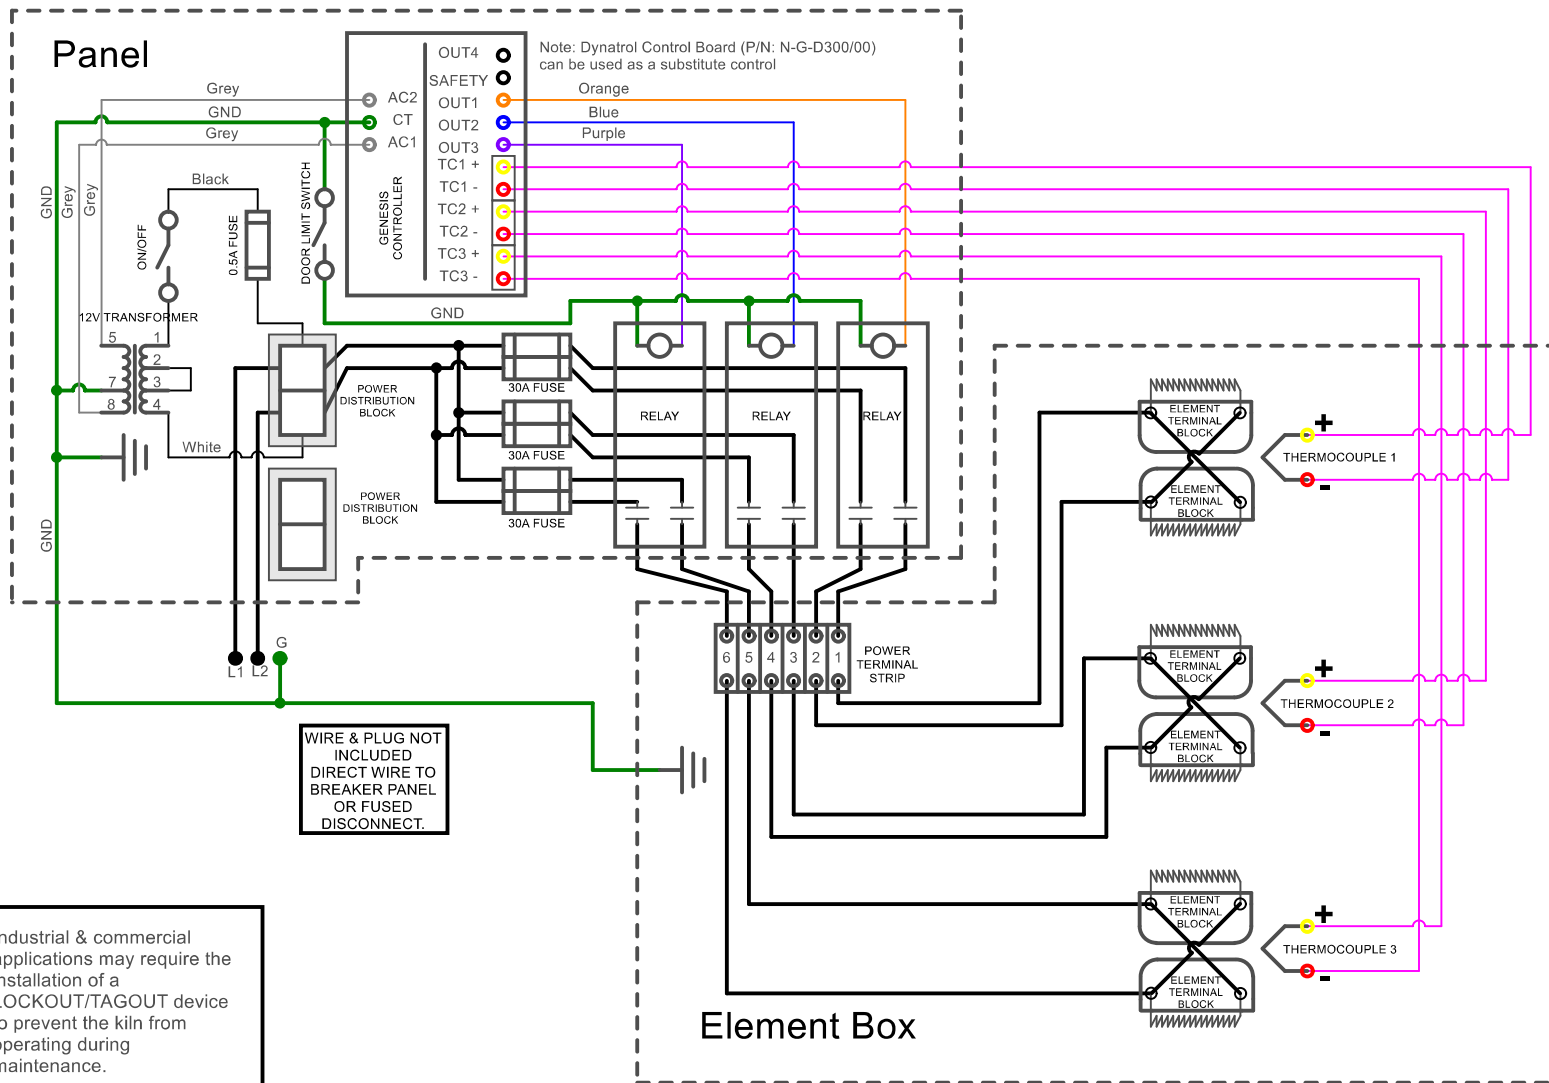

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: eFL2626-208	
Voltage	208 / 1 / 50-60
Watts	15,360
Full Load Amps	L1 73.8 L2 73.8 L3
Power Supply	Fuse 100A Wire 3AWG
Elements	QTY OHMS
E-H-2626/21	6 16.3

Model: eFL2626-220	
Voltage	220 / 1 / 50-60
Watts	15,360
Full Load Amps	L1 69.8 L2 69.8 L3
Power Supply	Fuse 90A Wire 3AWG
Elements	QTY OHMS
E-H-2626/41	6 18.2

Model: eFL2626-240	
Voltage	240 / 1 / 50-60
Watts	15,360
Full Load Amps	L1 64.0 L2 64.0 L3
Power Supply	Fuse 80A Wire 4AWG
Elements	QTY OHMS
E-H-2626/31	6 21.7

eFL2626 1 Phase
208V, 220V, 240V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

Rev. Date Description C0078