


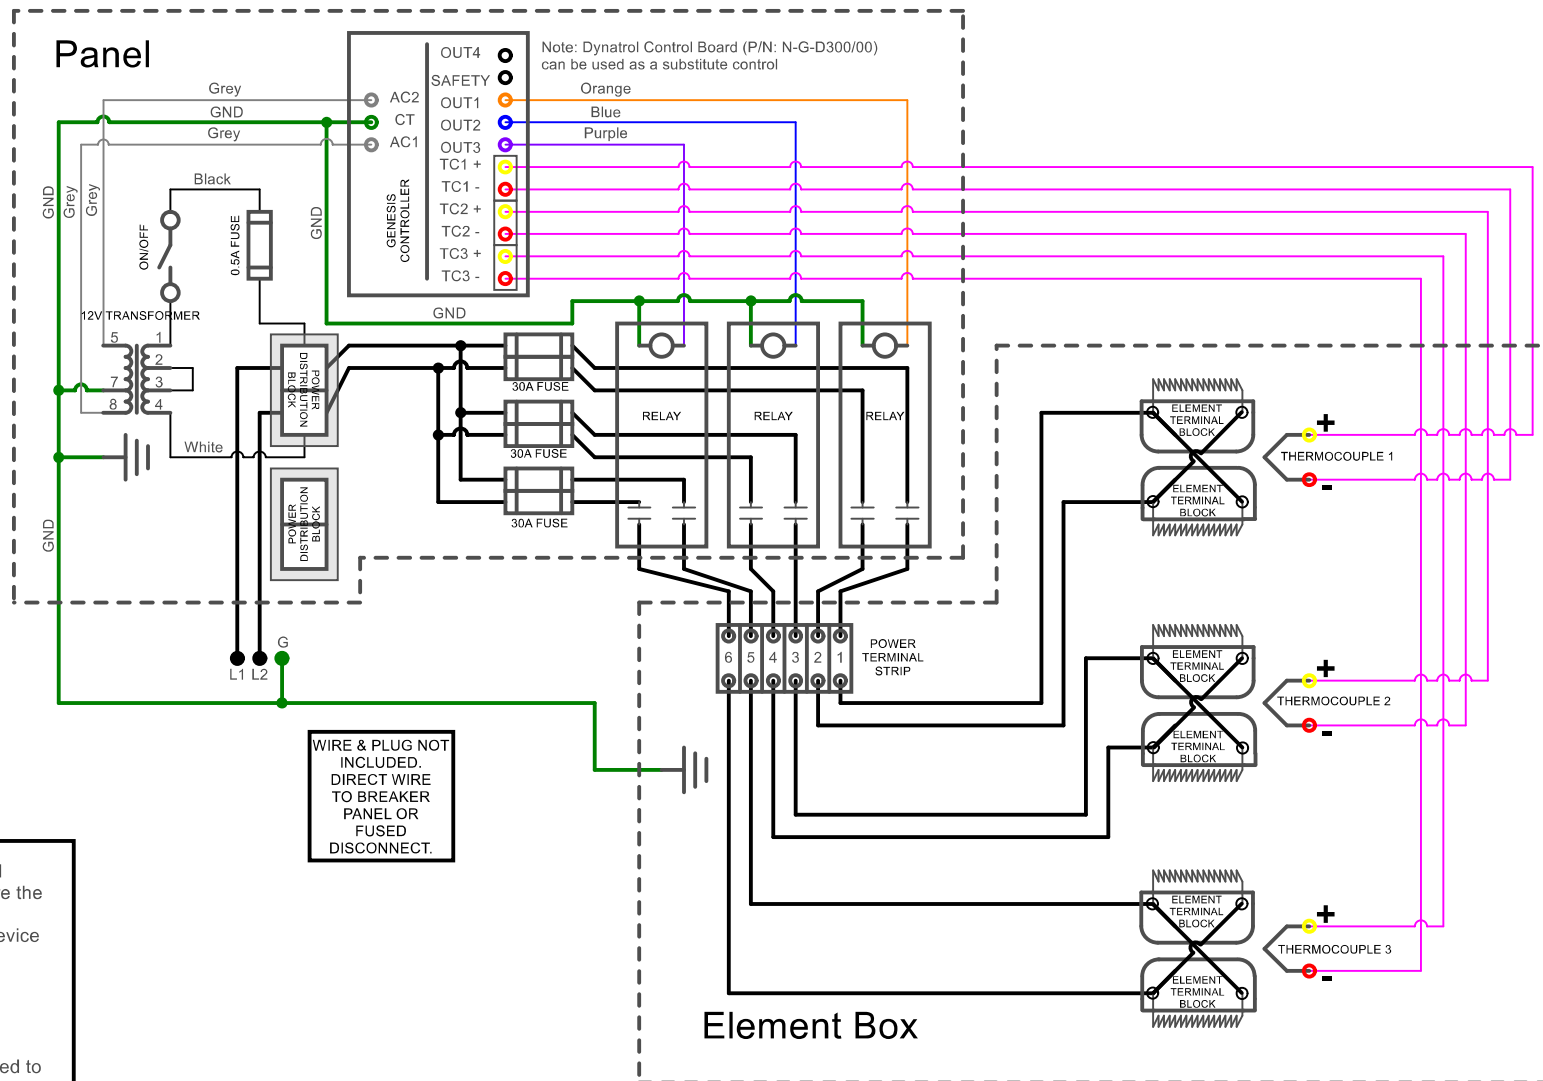

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: eQ2327-208	
Voltage	208 / 1 / 50-60
Watts	11,648
Full Load Amps	L1 56.0 L2 56.0 L3
Power Supply	Fuse 70A Wire 4AWG
Elements	QTY OHMS
E-Q-2327/20	6 21.5

Model: eQ2327-220	
Voltage	220 / 1 / 50-60
Watts	12,320
Full Load Amps	L1 56.0 L2 56.0 L3
Power Supply	Fuse 70A Wire 4AWG
Elements	QTY OHMS
E-Q-2327/40	6 22.7

Model: eQ2327-240	
Voltage	240 / 1 / 50-60
Watts	13,440
Full Load Amps	L1 56.0 L2 56.0 L3
Power Supply	Fuse 70A Wire 4AWG
Elements	QTY OHMS
E-Q-2327/30	6 24.8

eQ2327 eQuad-Pro 1 Phase 208V, 220V, 240V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

Rev.	Date	Description	C0086
------	------	-------------	-------