


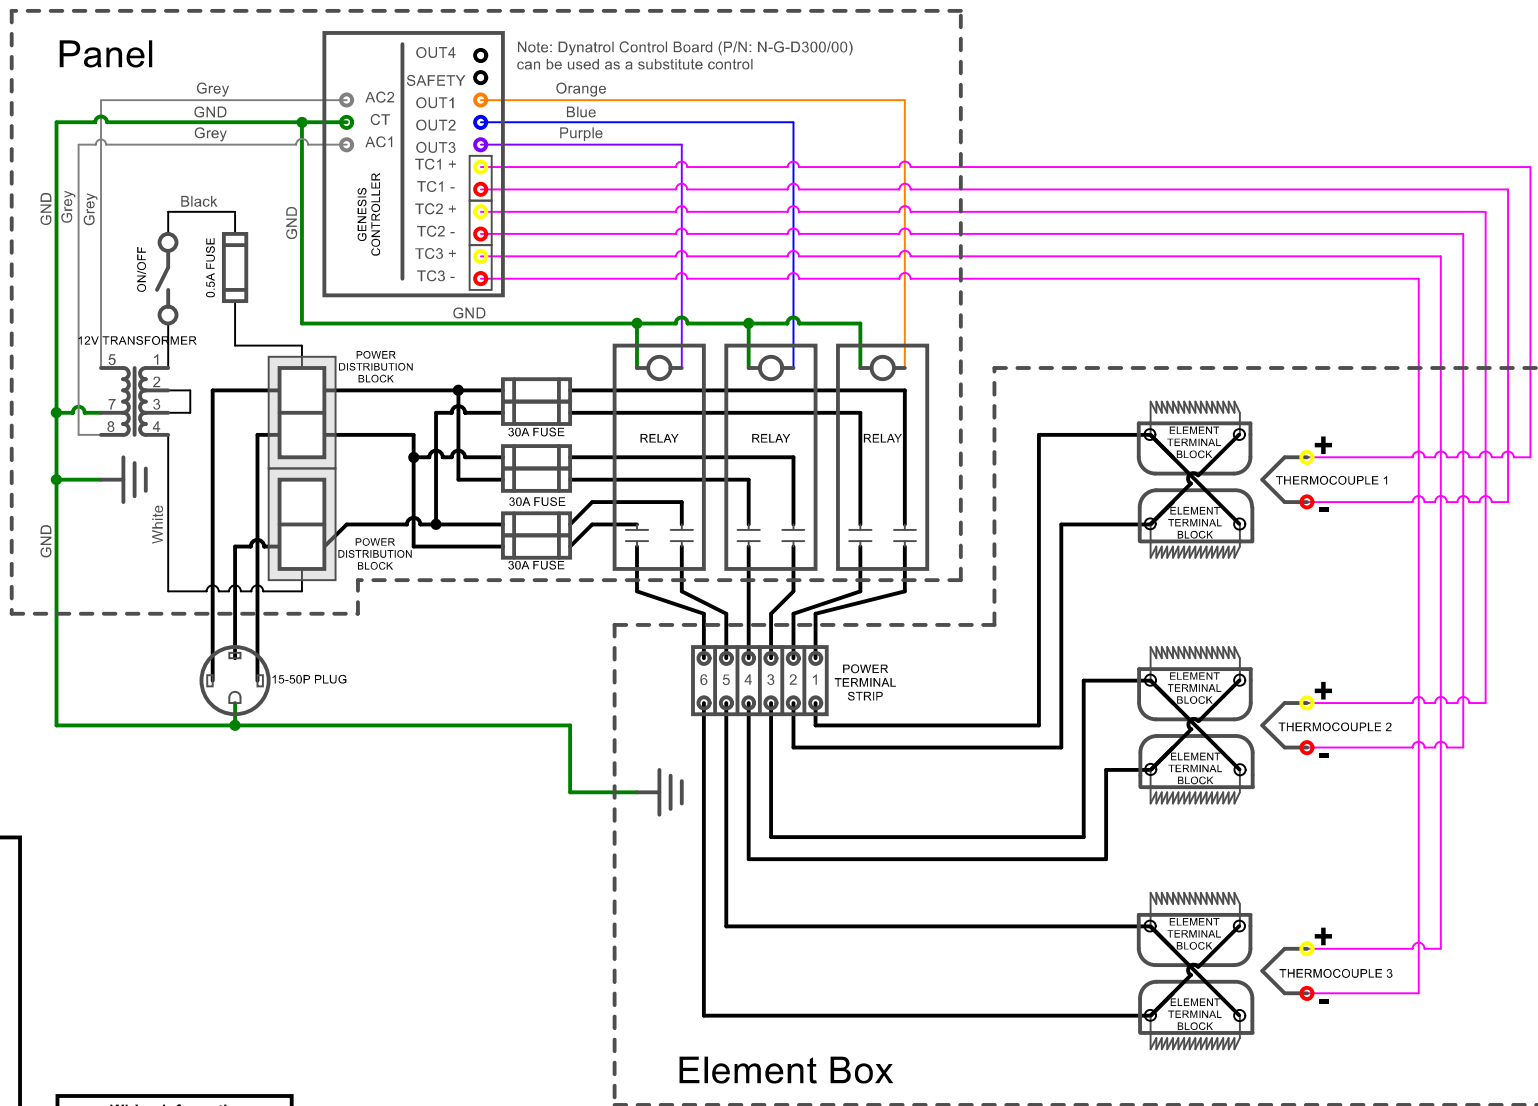

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size	

Model: eQ2827-208-3P			
Voltage	208 / 3 / 50-60		
Watts	14,950		
Full Load Amps	L1	L2	L3
	41.5	41.5	41.5
Power Supply	Fuse	Wire	
	60A	6AWG	
Elements	QTY	OHMS	
	E-Q-2827/20	6 16.7	

Model: eQ2827-240-3P			
Voltage	240 / 3 / 50-60		
Watts	14,950		
Full Load Amps	L1	L2	L3
	36.0	36.0	36.0
Power Supply	Fuse	Wire	
	50A	8AWG	
Elements	QTY	OHMS	
	E-Q-2827/30	6 22.3	

eQ2827 eQuad-Pro 3 Phase
208V, 240V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

C0091

Rev. Date Description