


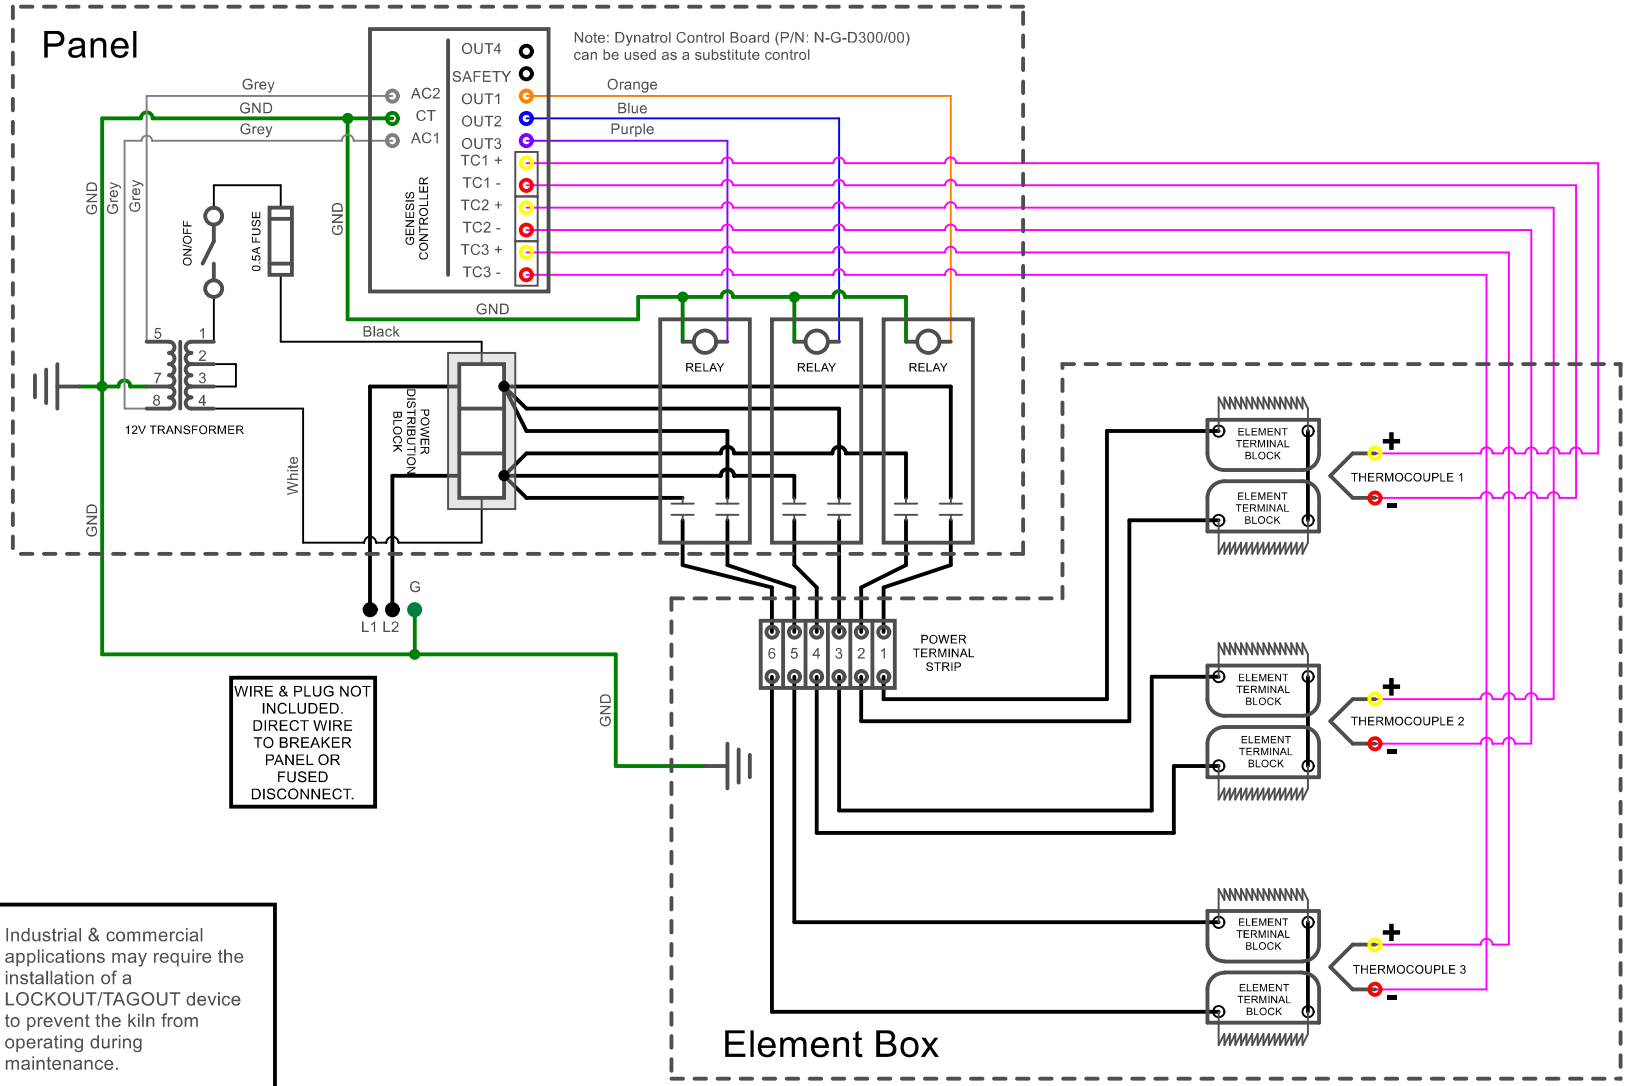

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information			
Power	10AWG / 150°C / 600V		
Control	16-22AWG / 105°C / 600V		
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size .			

Model: e18T-220			
Voltage	220 / 1 / 50-60		
Watts	8,400		
Full Load Amps	L1	L2	L3
	38.2	38.2	
Power Supply	Fuse	Wire	
	50A	8AWG	
Elements	QTY	OHMS	
	E-E-18TL/41	6	8.32

E18T Easy-Fire 1 Phase 220V 220V			 505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com (856)-294-0077 Drawn by: JS C0011
Rev.	Date	Description	