


Panel

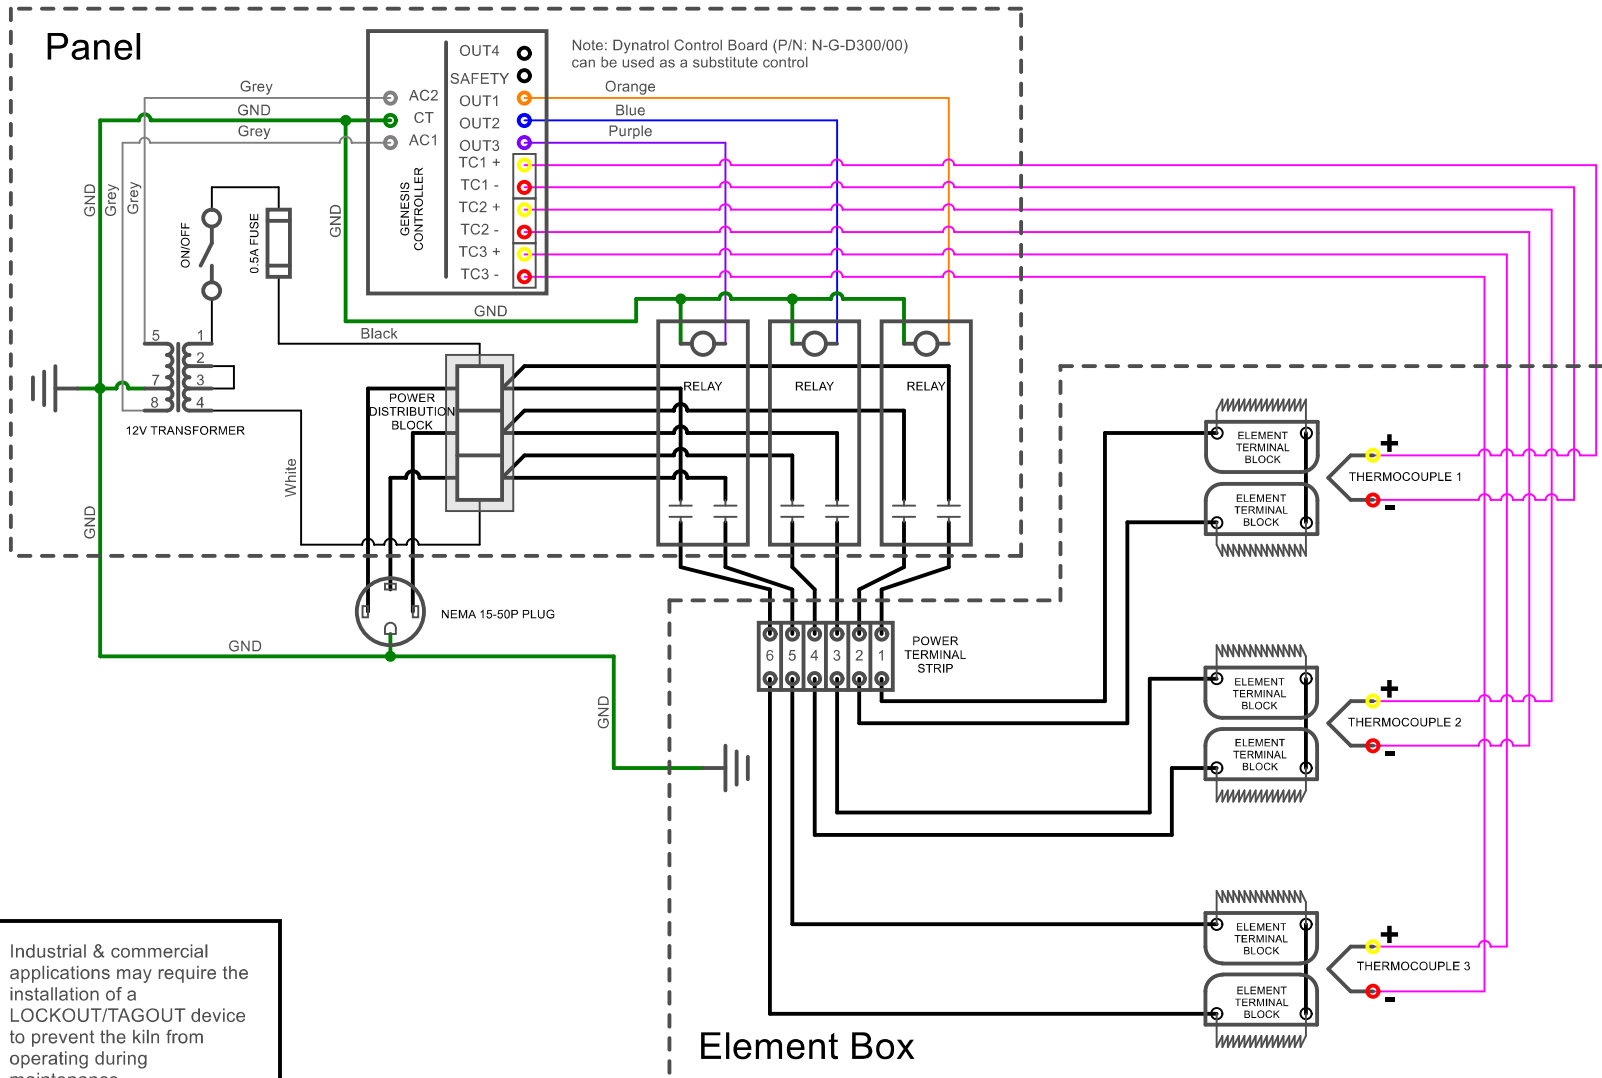

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power:	10AWG / 150°C / 600V
Control:	16-22AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: e18T-208-3P			
Voltage	208 / 3 / 50-60		
Watts	8,400		
Full Load Amps	L1	L2	L3
	23.3	23.3	23.3
Power Supply	Fuse	Wire	
	30A	10AWG	
Elements	QTY	OHMS	
E-E-18TL/21	6	7.44	

Model: e18T-240-3P			
Voltage	240 / 3 / 50-60		
Watts	8,400		
Full Load Amps	L1	L2	L3
	20.2	20.2	20.2
Power Supply	Fuse	Wire	
	30A	10AWG	
Elements	QTY	OHMS	
E-E-18TL/31	6	9.90	

E18T Easy-Fire 3 Phase 208V, 240V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

C0014

Rev. Date Description