


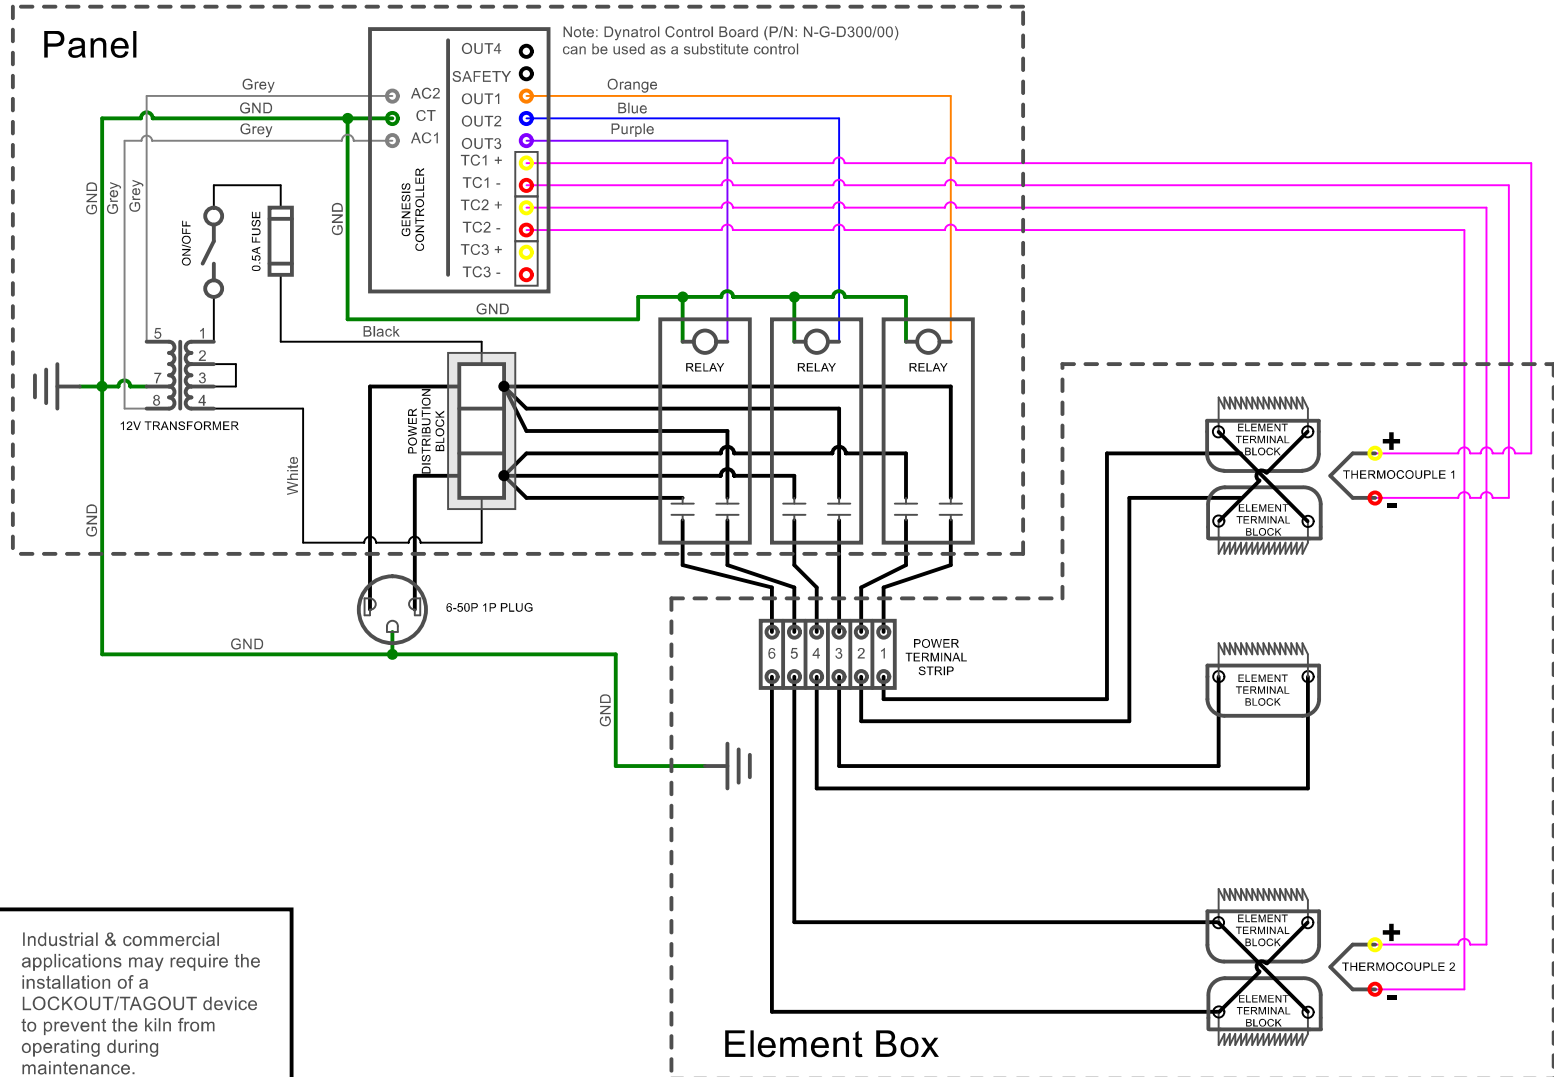

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	10AWG / 150°C / 600V
Control	16-22AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper-Wire. See hotkilns.com/wire-size.	

Model: e28M-208			
Voltage	208 / 1 / 50-60		
Watts	9,985		
Full Load Amps	L1	L2	L3
	48.0	48.0	
Power Supply	Fuse	Wire	
	60A	6AWG	
Standard Elements: E-E-28ML/21			
Quad Elements: E-E-28MQ/21			
Quantity: 5		Ohms: 20.9	

Model: e28M-240			
Voltage	240 / 1 / 50-60		
Watts	11,520		
Full Load Amps	L1	L2	L3
	48.0	48.0	
Power Supply	Fuse	Wire	
	60A	6AWG	
Standard Elements: E-E-28ML/31 Quad Elements: E-E-28MQ/31			
Quantity: 5		Ohms: 24.1	

E28M Easy-Fire 1 Phase 208V, 240V			 505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com (856)-294-0077 Drawn by: JS C0028
Rev.	Date	Description	