


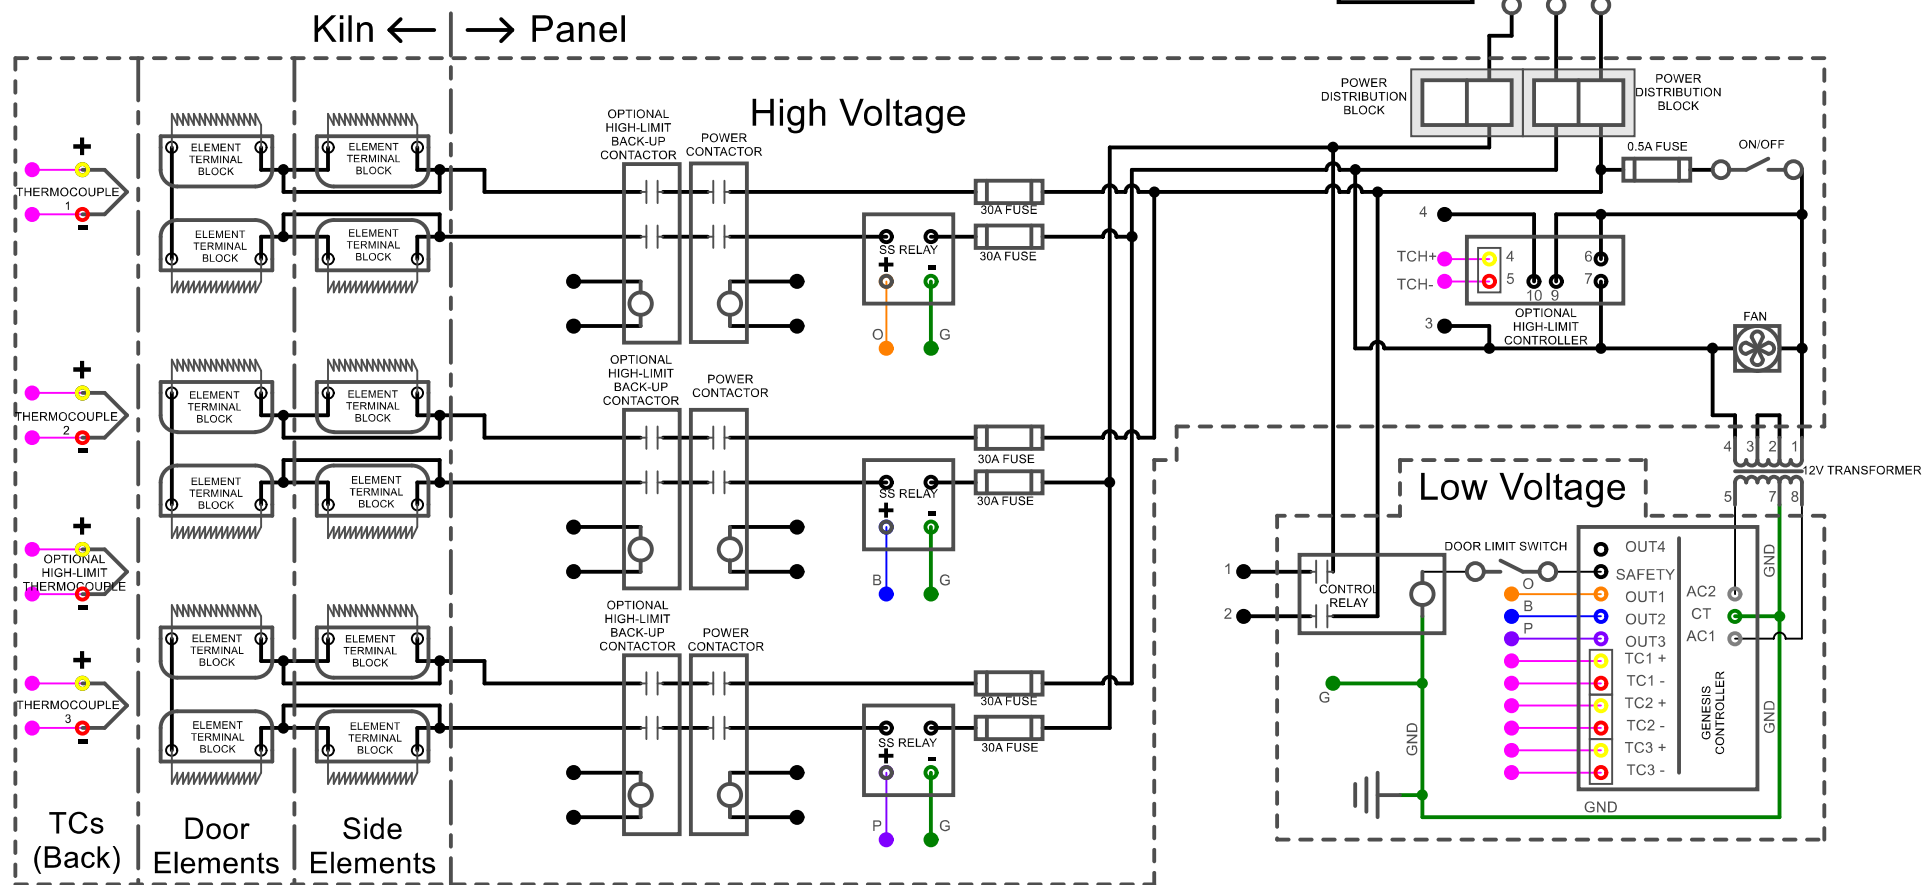

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Model: EL2427-208-3P			
Voltage	208 / 3 / 50-60		
Watts	16,500		
Full Load Amps	L1	L2	L3
	45.8	45.8	45.8
Power Supply	Fuse	Wire	
	60A	6AWG	
Side Elements: E-Z-2427/2S			
Quantity: 6	Ohms: 11.4		
Door Elements: E-Z-2427/2D			
Quantity: 6	Ohms: 3.8		

Model: EL2427-240-3P			
Voltage	240 / 3 / 50-60		
Watts	16,500		
Full Load Amps	L1	L2	L3
	39.7	39.7	39.7
Power Supply	Fuse	Wire	
	50A	8AWG	
Side Elements:	E-Z-2427/3S		
Quantity: 6	Ohms: 15.1		
Door Elements:	E-Z-2427/3D		
Quantity: 6	Ohms: 5		

EL2427 3 Phase 208V, 240V



505 Sharptown Road
Swedesboro NJ 08085
service@hotkilns.com
(856)-294-0077

Drawn by: JS

C0051