


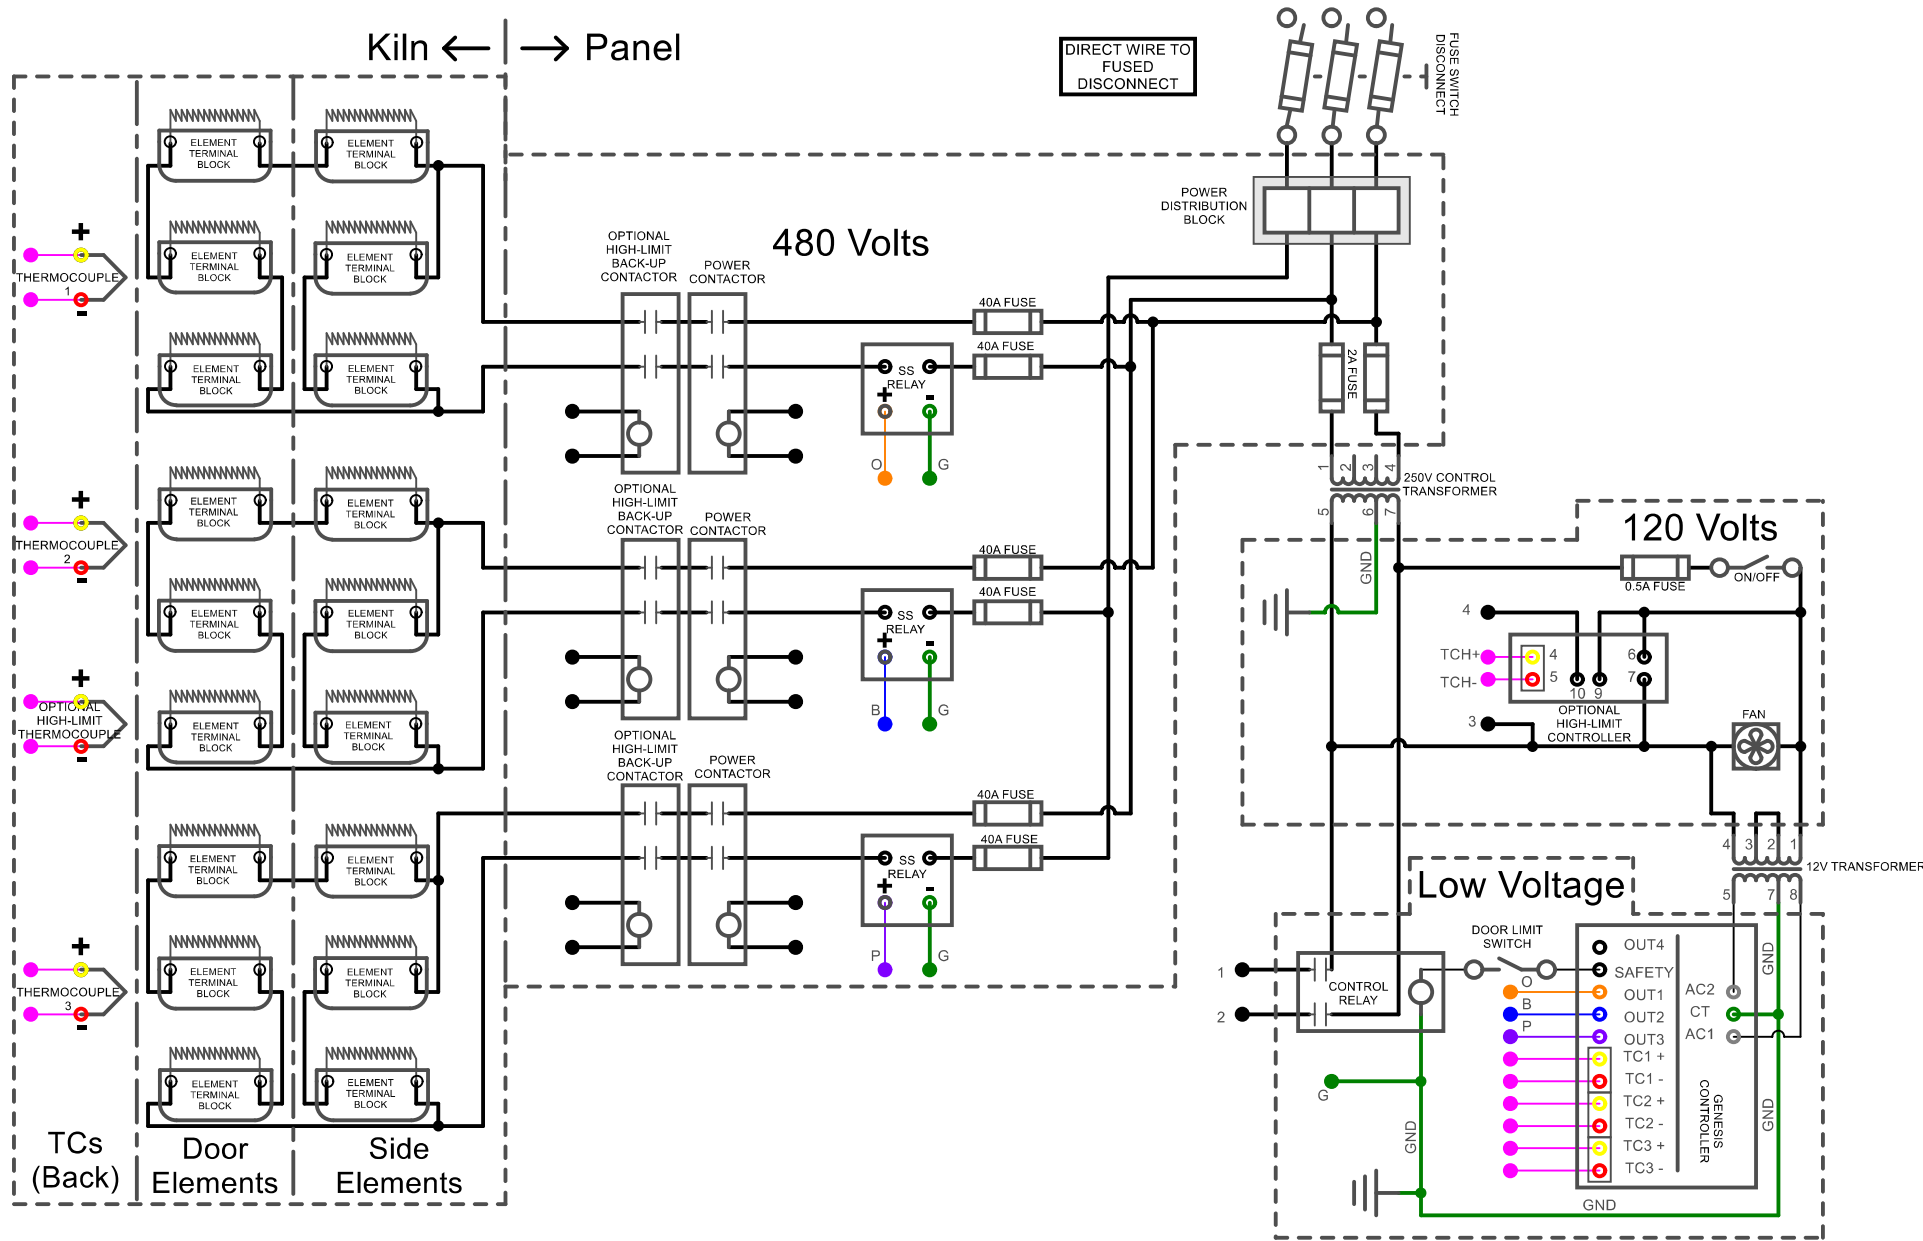

Industrial & commercial applications may require the installation of a LOCKOUT/TAGOUT device to prevent the kiln from operating during maintenance.

This kiln is recommended to be wired & connected to an approved U. L. & NEC configured receptacle controlled with a disconnect switch and properly fused according to the kW load specification listed on the kiln nameplate. L&L Kiln Mfg., Inc., also recommends fuses rather than circuit breakers to prevent nuisance tripping.

Wiring Information	
Power	6AWG / 150°C / 600V
Control	16AWG / 105°C / 600V
Power Supply Wire Gauge assumes 75°C Copper Wire. See hotkilns.com/wire-size.	

Model: EL3048-480-3P	
Voltage	480 / 3 / 50-60
Watts	31,500
Full Load Amps	L1 L2 L3
	37.9 37.9 37.9
Power Supply	Fuse Wire
	50A 8AWG
Side Elements	E-Z-3048/3S
Quantity: 9	Ohms: 21.1
Door Elements	E-Z-3048/3D
Quantity: 9	Ohms: 7

EL3048 3 Phase 480V 480V			
		505 Sharptown Road Swedesboro NJ 08085 service@hotkilns.com	
		(856)-294-0077	
A		Drawn by: JS	
Rev.	Date	Description	